# BEFORE THE WASHINGTON UTILITIES AND TRANSPORTATION COMMISSION

In the Matter of the Investigation of	
AVISTA CORPORATION d/b/a AVISTA UTILITIES, PUGET SOUND ENERGY, and PACIFIC POWER & LIGHT COMPANY,	Docket UE-190882
Regarding the Prudency of Outage and Replacement Power Costs	
In the Matter of	
PACIFIC POWER & LIGHT COMPANY,	Docket UE-190458
2018 Power Cost Adjustment Mechanism	

### PACIFIC POWER & LIGHT COMPANY

# REDACTED – COMPANY-CONFIDENTIAL REBUTTAL TESTIMONY OF CHARLES L. TACK

## **TABLE OF CONTENTS**

I.	Purpose and Summary	1
II.	Prudence of Pacific Power's Oversight of Talen	3
III.	Prudence of Talen's Actions	5
A	A. Timeline of Talen's Actions Before the Outage	5
В	3. Alternate Indicators	5
C	C. Burning Area A Coal	9
D	D. Taking a Planned Outage	11
VI.	Conclusion	15

## ATTACHED EXHIBITS

Exhibit CLT-15CC (Company Confidential) - MATS PM Results and Trends in the Alternate Indicators

1	Q.	Are you the same Charles L. Tack who submitted supplemental direct testimony
2		on behalf of PacifiCorp dba Pacific Power and Light Company (Pacific Power or
3		Company) in this proceeding?
4	A.	Yes.
5		I. PURPOSE AND SUMMARY
6	Q.	What is the purpose of your rebuttal testimony?
7	A.	My rebuttal testimony addresses the response testimony of Mr. David C. Gomez on
8		behalf of Staff of the Washington Utilities and Transportation Commission (Staff)
9		and the response testimony of Mr. Avi Allison on behalf of the Washington State
10		Office of the Attorney General, Public Counsel Unit (Public Counsel). Both parties
11		ask the Washington Utilities and Transportation Commission (Commission) to
12		determine that Pacific Power's actions leading up to the 2018 Colstrip Outage were
13		imprudent either (1) directly, by failing to adequately supervise Colstrip's operator,
14		Talen Montana, LLC (Talen), or (2) indirectly, by attributing Talen's actions to
15		Pacific Power and arguing that Talen imprudently operated the plant.
16	Q.	Please summarize your rebuttal testimony.
17	A.	My testimony responds to four concerns raised by Staff and Public Counsel:
18		• First, Staff and Public Counsel argue that Pacific Power was imprudent in
19		failing to adequately supervise and oversee Talen's actions as the operator.
20		I explain that Pacific Power acted consistent with its responsibility to
21		adequately manage and oversee the utility operator as a member of the
22		plant's Ownership and Operating (O&O) Committee by staying in close
23		contact with Talen management, inquiring about steps taken to investigate

1	the elevated Mercury and Air Toxics Standards (MATS) Particulate
2	Matter (PM) test results, and asking clarifying questions where necessary.
3	Pacific Power was actively engaged, and it was reasonable for the
4	Company to rely on Talen's day-to-day actions and reports as it
5	investigated PM levels.
6	• Second, on the premise that Pacific Power is responsible for any
7	imprudence by Talen, Staff and Public Counsel further challenge Talen's
8	reliance on alternate indicators,
9	
10	. I explain that Talen's response to
11	the elevated PM readings treated the issue with the appropriate degree of
12	care, consistent with operational best practices. Talen reasonably relied on
13	alternate indicators,
14	
15	
16	
17	• Third, Staff incorrectly contends that Pacific Power made affirmative
18	misrepresentations in the discovery process by stating that it was unaware
19	of an "investigation" undertaken before the 2018 forced outage. Pacific
20	Power's responses described the troubleshooting undertaken before the
21	outage, while distinguishing these efforts from a formal, post-outage
22	investigation.
23	• Fourth,

1		
2		
3		
4		The final MDEQ Penalty Assessment, which is the most
5		accurate and complete portrayal of the PM issue, did not conclude that the
6		outage was foreseeable.
7		II. PRUDENCE OF PACIFIC POWER'S OVERSIGHT OF TALEN
8	Q.	Mr. Gomez states that Pacific Power is "responsible for the actions of the
9		Operator of Colstrip Units 3 and 4." What do you understand to be the
10		appropriate standard to evaluate Pacific Power's prudent oversight of Talen?
11	A.	As discussed in the rebuttal testimony of Mr. Michael G. Wilding, my understanding
12		is that a utility co-owner is responsible for demonstrating adequate management and
13		oversight of a plant operator. <sup>2</sup> Under this standard, Pacific Power's actions as a
14		minority owner of Colstrip Unit 4 were reasonable and prudent. Furthermore, based
15		on Pacific Power's management and oversight, Talen's actions were reasonable and
16		prudent.

<sup>1</sup> DCG-1CCT at 15.

<sup>&</sup>lt;sup>2</sup> Wash. Utils. and Transp. Comm'n v. Qwest Corp. d/b/a CenturyLink QC, Docket UT-140597, Order 03 ¶ 25 (Feb. 22, 2016).

1	Q.	Both Mr. Gomez and Mr. Allison claim that Pacific Power did not provide
2		sufficient oversight of or input into Talen's actions leading up to the outage. <sup>3</sup> Do
3		you agree?
4	A.	No. As I have previously explained, <sup>4</sup> Pacific Power is a minority owner of Colstrip
5		Unit 4, the operation of which is governed by the O&O Agreement. Under the O&O
6		Agreement, Pacific Power's oversight and input is provided through a
7		representative's participation on the O&O Committee. As Pacific Power's
8		representative, I actively monitored and provided input on major operational issues
9		associated with Colstrip Unit 4. As events actually unfolded, I regularly engaged
10		with and questioned Talen on the facilities' PM levels and trouble-shooting efforts. <sup>5</sup>
11		During this process, Pacific Power reasonably relied on the representations made by
12		Talen that the elevated PM levels in the February 2018 official test seemed to be
13		anomalous, particularly in light of the other available indicators suggesting that the
14		plant was performing well.
15	Q.	Did you have any reason to believe that Talen's actions in response to the
16		elevated PM levels were unreasonable or imprudent?
17	A.	No. In my observation, Talen understood the importance of the elevated PM results
18		and attended to the issue in a manner fully consistent with operational best practices
19		and the concern the Colstrip owners expressed. As the plant operator, Talen's history
20		of performance has demonstrated prompt and focused attention in response to other
21		equipment challenges at Colstrip, as demonstrated by the top quartile availability


 $<sup>^3</sup>$  Gomez, Exh. DCG-1CCT, Allison, Exh. AA-1CT at 20.  $^4$  CLT-1CCT at 2.

<sup>&</sup>lt;sup>5</sup> CLT-1CCT at 3-5.

1		rates at the plant. Pacific Power reasonably believed that Talen would continue to
2		perform consistent with prudent operational practices.
3		III. PRUDENCE OF TALEN'S ACTIONS
4	A.	Timeline of Talen's Actions Before the Outage
5	Q.	Mr. Gomez provides a timeline of the events and major decision points leading
6		up to the outage. Does this timeline tell the whole story?
7	A.	No. Significant actions were left out, including monitoring and evaluations that took
8		place from the official February MATS PM testing to the official MATS PM testing
9		in June. This missing information is significant because it shows that Talen took the
10		elevated PM levels seriously, and that Talen's response was prudent and reasonable.
11		These actions were previously discussed more thoroughly in Exhibit CLT-9CC,
12		which includes the alternate indicators that were being monitored as well as the
13		results of that monitoring. Additionally, Exhibit CLT-5CC is an email from Talen
14		discussing actions that it began taking in February 2018 in response to the elevated
15		PM levels.
16	В.	Alternate Indicators
17	Q.	Both Mr. Gomez and Mr. Allison contend that
18		
19		
20	A.	
21		
22		

<sup>&</sup>lt;sup>6</sup> Gomez Exh. DCG-1CCT at 29-31.

<sup>7</sup> Allison, Exhibit AA-1CT at 13-14, Gomez Exh. DCG-1CCT at 47.

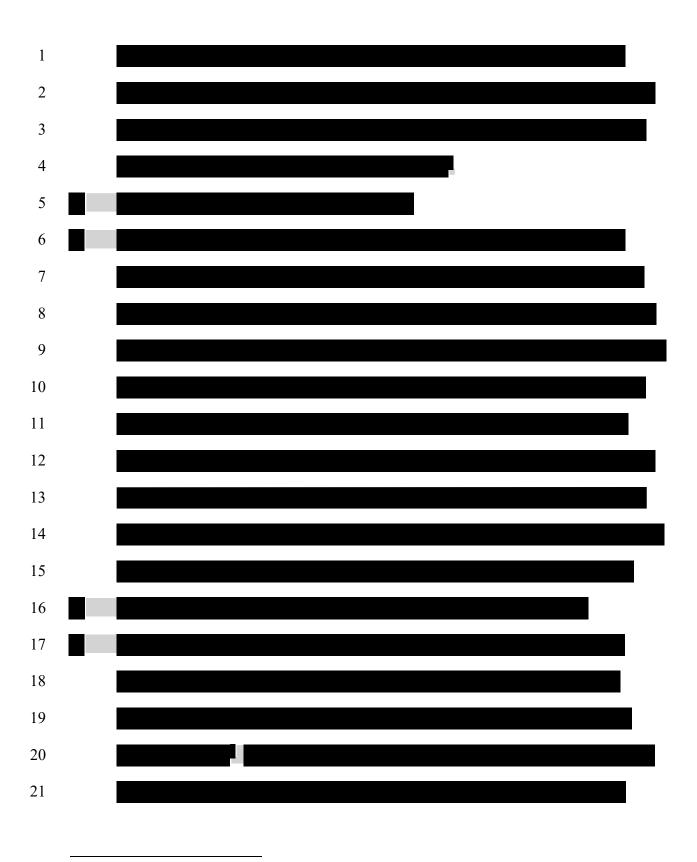


<sup>9</sup> Exhibit CLT-15CC.

1						
2						
3						
4						
5						
6						
7						
8					_	
9						
10						
11						
12						
13						
14						
15						
16						
17						
18						
19	=					
20						
21						
22						
23						
23						

1	
2	
3	
4	
5	
6	
7	
8	
9	
10	
11	
12	
13	
14	
15	
16	


<sup>10</sup> Exhibit CLT-10CC at 4. 11 DCG-1CCT at 48 n.165 12 Exhibit CLT-1CCT at 8-9.

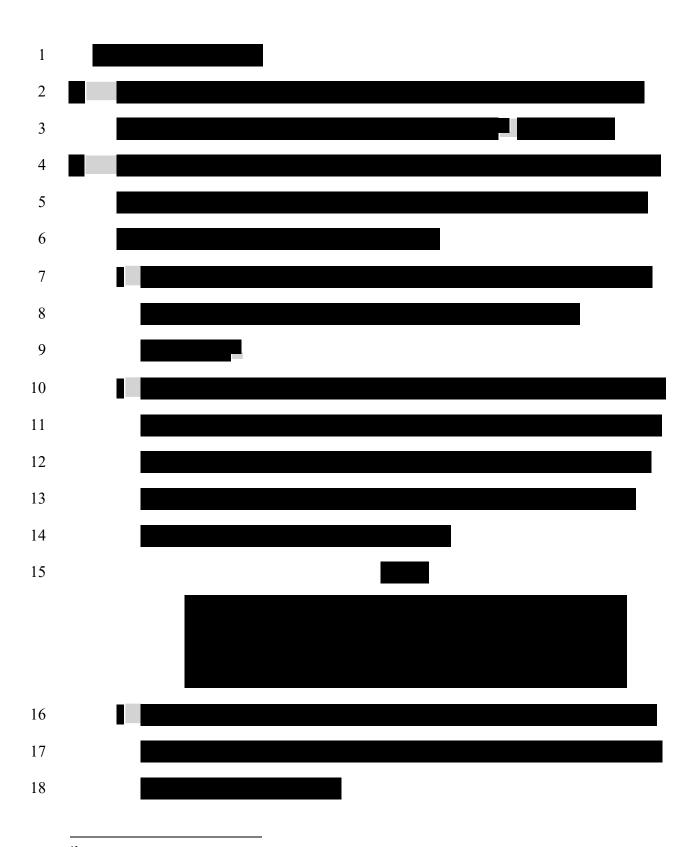

<sup>&</sup>lt;sup>13</sup> DCG-1CCT at 39.

<sup>&</sup>lt;sup>14</sup> While Units 1 and 2 have different operating parameters than Units 3 and 4, Talen operates all of these units and thus has considerable experience with and knowledge of Area A coal.

<sup>&</sup>lt;sup>15</sup> DCG-1CCT at 39:18.

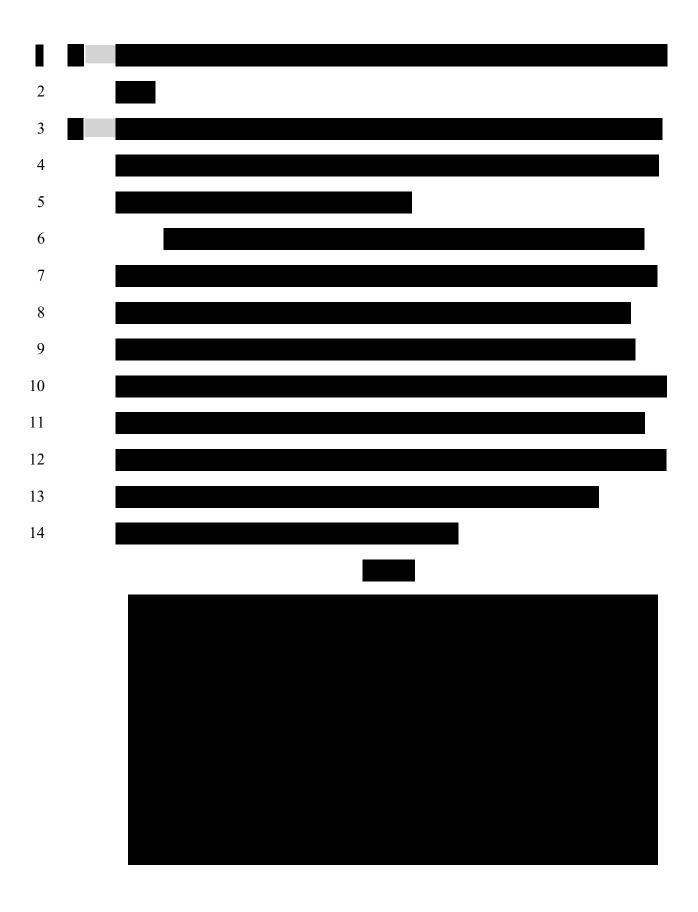

1		
2		
3		16
4	D.	Taking a Planned Outage
5	Q.	
6		Is it typical to take a unit
7		offline whenever an elevated parameter is detected?
8	A.	Absolutely not. As a general matter, an operator does not take a planned outage
9		without reasonable certainty that the outage is inevitable and/or there is a clear plan to
10		respond to the underlying problem. For instance, in 2013, Pacific Power experienced
11		an outage at the Chehalis coal plant when one of the bushings in the unit's step-up
12		transformer failed. <sup>18</sup> While Pacific Power had experienced two prior outages at the
13		Chehalis plant related to bushing failures, RCAs following those prior outages had
14		been unable to pinpoint whether the failures had been "anomalies or indicative of a
15		widespread issue with the transformer or bushings[.]"19 In the absence of a clear
16		cause, Pacific Power decided that taking a planned outage to attempt repairs would be
17		imprudent because it would ensure negative cost impacts based on "speculation, not
18		facts[.]"20 Rejecting arguments that Pacific Power's actions were imprudent, the
19		Commission concluded that Pacific Power's operation of the plant was prudent. <sup>21</sup>

Exhibit CLT-10CC at 4.

<sup>&</sup>lt;sup>17</sup> DCG-1CCT at 52.

<sup>&</sup>lt;sup>18</sup> Wash. Utils. and Transp. Comm'n v. Pac. Power and Light Co., Docket UE-140762, Rebuttal Testimony of Dana M. Ralston, Exhibit No. DMR-2T at 2.

<sup>&</sup>lt;sup>19</sup> Docket UE-140762, Rebuttal Testimony of Dana M. Ralston, Exhibit No. DMR-2T at 5:3.

<sup>&</sup>lt;sup>20</sup> Docket UE-140762, Rebuttal Testimony of Dana M. Ralston, Exhibit No. DMR-2T at 4:9-11.

<sup>&</sup>lt;sup>21</sup> Docket UE-140762, Order 08 ¶ 104 (Mar. 25, 2015).

1		
2		
3		
4		
5		
6		
7		
8		
9		
10		
11		
12		
13		
14	Q.	Do Staff and Public Counsel inappropriately seek to deny all cost recovery on the
15		theory that there should have been a planned outage in the spring rather than the
16		forced outage in June?
17	A.	Yes. Both Staff and Public Counsel ask the Commission to disallow the <i>entirety</i> of
18		the Company's replacement power costs. <sup>22</sup> While we cannot know the precise
19		impacts of a planned outage in the spring, a spring outage would have had its own
20		cost consequences. Replacement power costs in the spring would have been lower,
21		but the outage may have been longer in duration and may not have succeeded in
22		resolving the multi-factor causes of the PM exceedance. Given the complexity of the

<sup>&</sup>lt;sup>22</sup> AA-1CT at 22; DCG-1CCT at 54.

1		underlying problem, it is possible that Talen could have taken the units offline in the
2		spring, been unable to identify the multi-factor causes of the elevated PM reading,
3		brought the units back online, and then suffered the same forced outage.
4	Q.	Should Talen have known that Colstrip Units 3 and 4 would not pass the Q2 PM
5		tests?
6	A.	No. Talen could not reasonably have known that its troubleshooting efforts would be
7		unsuccessful or that the alternate indicators were, suddenly and without precedent,
8		not reliable predictors of the units' PM levels. Without the benefit of perfect
9		hindsight, there was no reason for Talen to have taken these fully compliant units
10		offline before completing a thorough assessment of the causes of the elevated PM test
11		and ruling out the possibility of an abnormal PM reading.
12		
13		
14		And as I previously explained,
15		taking the generating units offline would also have complicated Talen's effort to
16		identify the cause of the elevated PM test results and may not have reduced the
17		overall cost impact on customers.
18	Q.	
19		
20		
21	A.	An outage related to a PM exceedance is not a discretionary outage that may be
22		timed to coincide with low market prices. If Pacific Power had seen or been made

-

<sup>&</sup>lt;sup>23</sup> DCG-1CCT at 52.

aware of any credible evidence that the official MATS PM was going to fail, it would have advocated to immediately develop a plan, evaluate risks, understand impacts, and prepare to shut the units down depending on outcome of the information gathered. Based on the alternate indicators, additional monitoring, and Talen's significant operating experience, Talen reasonably concluded that the units would pass the official MATS PM compliance tests in June, and Pacific Power reasonably relied on Talen's assessment.

#### IV. PACIFIC POWER'S STATEMENTS DURING DISCOVERY

Mr. Gomez states that Pacific Power denied knowledge of an investigation into the elevated PM levels at Colstrip.<sup>24</sup> Is that accurate?

No. The response cited by Staff is based on my interpretation of what Staff meant by "investigation," which I understood to mean the official root cause investigation that commenced only after the PM levels exceeded permit levels in Q2. In the same paragraph as the statement in question quoted by Staff, Pacific Power discusses the additional monitoring that took place in Q1.<sup>25</sup> Although additional monitoring is sometimes used interchangeably with the term "investigation," in this response, I was distinguishing between: (1) the additional monitoring and trouble-shooting efforts that took place in Q1 due to the "rise in particulate matter levels" that still met compliance requirements, from (2) the official investigation—the RCA—that took place after particulate matter levels exceeded compliance requirements in Q2.

The intent of the original data response was to clarify that the official MATS

PM results (although elevated) were within compliance and did not require an official

Q.

A.

<sup>&</sup>lt;sup>24</sup> Gomez, Exh. DCG-1CCT at 27.

 $<sup>^{25}</sup>$  Id

1	investigation. Therefore, additional monitoring (increased attention) and internal
2	evaluation of that data took place, rather than a formal root cause investigation.
3	Pacific Power was aware of and engaged with multiple efforts Talen was undertaking
4	as a result of the rise in particulate matter readings.
5	V. THE MDEQ CONSENT DECREE AND PENALTY ASSESSMENT
6	
7	
8	
9	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	

 $<sup>^{26}</sup>$  Gomez, Exh. DCG-1CCT at 13; Allison, Exh. AA-1CCT at 10.  $^{27}$  DCG-1CCT at 13; AA-1CT at 10.

1		
2		
3		
4		
5		
6		
7		
8		
9		
10	Q.	How do the determinations in the final and more accurate version of the MDEQ
11		Penalty Assessment ?
12	A.	
13		
14		Together, these documents represent the
15		most accurate and reliable factual record of the incident.
16		

<sup>&</sup>lt;sup>28</sup> AA-1CT at 10; DCG-1CCT at 13.
<sup>29</sup> DCG-1CCT at 13 n.42; AA-1CT at 10 ("It appears that, in the process of negotiating a final settlement with Talen, MDEQ removed from its final penalty factors description the language explicitly describing the MATS exceedance as 'foreseeable'").

1	Q.	
2		
3		
4		
5	A.	
6		MDEQ could have applied a larger penalty based on "circumstances,"
7		including, among other factors, "how much control the source had over the
8		violation[.]"31 Instead, in the final penalty calculation, MDEQ imposed a relatively
9		minor 8 percent circumstances penalty—\$680 added to a \$8,500 daily base penalty.
10		MDEQ also recognized that "prior to the second quarter 2018 Talen had no history of
11		noncompliance with the MATS" and "Talen made efforts to understand the PM
12		emission performance once the compliance margin was reduced."32
13		VI. CONCLUSION
14	Q.	Please summarize your testimony.
15	A.	Pacific Power exercised reasonable oversight and management of its interest in
16		Colstrip Unit 4 in the events leading up to the forced outage in June 2018. Pacific
17		Power closely monitored Talen's response to the elevated PM test results, which
18		followed operating best practices including the use of alternate indicators.
19		,
20		making clear that neither Pacific Power as a minority co-owner nor Talen as the plant
21		operator could have reasonably foreseen and prevented the outage.

<sup>&</sup>lt;sup>30</sup> DCG-1CCT at 12; AA-1CT at 10. <sup>31</sup> CLT-12 at 2. <sup>32</sup> CLT-12 at 2.

- 1 Q. Does this conclude your rebuttal testimony?
- 2 A. Yes.