

2011 Electric Service Reliability Report

© 2012 Avista Corporation. All Right Reserved

Permission of the Copyright owner is granted to users to copy, download, reproduce, transmit or distribute any part of this document provided that: (1) the user includes Avista's copyright notice on all copies, and (2) the materials are not used in any misleading or inappropriate manner. Furthermore, no portion of the attached work shall be republished in printed or digital form without the written permission of the Copyright owner.

TABLE OF CONTENTS

INTRODUCTION	1
DEFINITIONS	2
DATA COLLECTION AND CALCULATION CHANGES	
Data Collection	
Interruption Cause Codes	
Customers Experiencing Multiple Interruptions	
Major Events	
Table 1.1 – 2010 Major Event Days Customer Complaints	
SYSTEM INDICES	6
Table 2.1 - Reliability Statistic Target by Indice	
Chart 2.1 – SAIFI - Sustained Interruptions / Customer	
Chart 2.2 – Sustained Interruptions / Customer Historic Comparison	
Chart 2.3 - SAIFI Linear Trend Line Chart	
Chart 2.4 - MAIFI Momentary Interruption Events / Customer	
Chart 2.5 – Momentary Interruptions/ Customer Historic Comparison	
Chart 2.6 - SAIDI – Average Outage Time / Customer	
Chart 2.7 - SAIDI Linear Trend Line Chart	11
Chart 2.8 - CAIDI – Average Restoration Time	
OFFICE INDICES	12
Chart 3.1 – SAIFI - Sustained Interruptions / Customer	12
Chart 3.2 - MAIFI Momentary Interruption Events / Customer	12
Chart 3.3 - SAIDI – Average Outage Time / Customer	
Chart 3.4 - CAIDI – Average Restoration Time	13
AREAS OF CONCERN	
Cause Information	
Colville Area Work Plans	
Table 4.1 - Colville Area Major Reliability Projects by Feeder	
Table 4.2 - Colville Area Historical & Proposed Future Reliability Projects by Feeder	
Avista System Wide Work Plans	
Chart 4.1 – Squirrel Related Outages	
Avista System Wide Vegetation Management Plan	19
CUSTOMERS EXPERIENCING MULTIPLE INTERRUPTIONS	
Chart 5.1 - Avista Service Territory - $CEMI_n$	
Chart 5.3 - Davenport Office - $CEMI_n$	
Chart 5.4 - Deer Park Office - $CEMI_n$	
Chart 5.5 - Othello Office - $CEMI_n$	
Chart 5.6 - Palouse Office - $CEMI_n$	
Chart 5.7 - Lewis-Clark Office - $CEMI_n$	
Chart 5.8 - Spokane Office - CEMI $_n$	
Chart 5.9 - Sandpoint Office - CEMI _n	
Chart 5.10 - Kellogg Office - CEMI _n	
Chart 5.11 - Coeur d'Alene - CEMI _n	
Chart 5.12 - Grangeville Office - CEMI _n	
MONTHLY INDICES	32
Chart 6.1 – SAIFI - Sustained Interruptions / Customer	

Chart 6.2 - MAIFI Momentary Interruption Events / Customer	32
Chart 6.3 - SAIDI – Average Outage Time / Customer	33
Chart 6.4 - CAIDI – Average Restoration Time	33
CUSTOMER COMPLAINTS	3/1
Table 7.1 - Commission Complaints	
Table 7.1 - Commission Complaints Table 7.2 - Customer Complaints	
Table 7.2 - Customer Complaints	33
SUSTAINED INTERRUPTION CAUSES	
Table 8.1 - % SAIFI per Cause by Office	
Chart 8.1 – % SAIFI per Cause by Office	
Table 8.2 - % SAIDI per Cause by Office	
Chart 8.2 – % SAIDI per Cause by Office	
Table 8.3 - % SAIFI per Cause by Month	
Chart 8.3 – % SAIFI per Cause by Month	
Table 8.4 - % SAIDI per Cause by Month	
Table 8.4.1 Average Outage Time	
Chart 8.4 – % SAIDI per Cause by Month	44
MOMENTARY INTERRUPTION CAUSES	45
Table 9.1 - % MAIFI per Cause by Office	45
Table 9.1.1 - % MAIFI per Cause by Office (Washington only)	46
Chart 9.1 – % MAIFI per Cause by Office	
Table 9.2 - % MAIFI per Cause by Month	
Chart 9.2 – % MAIFI per Cause by Month	49
MAJOR EVENT DAY CAUSES	50
Chart 10.1 – % SAIFI by Cause Code for the Major Event Days	
Table 10.1 – % SAIFI by Sub Cause Code for the Major Event Days	
Table 10.2 – Yearly Summary of the Major Event Days	
INTERRUPTION CAUSE CODES	52
Table 11.1 – Interruption Cause Codes	
OFFICE AREAS	
Chart 12.1 – Office Areas	54
INDICES CALCULATIONS	55
Sustained Interruption	55
Momentary Interruption Event	55
SAIFI – System Average Interruption Frequency Index	55
MAIFI _E – Momentary Average Interruption Event Frequency Index	55
SAIDI – System Average Interruption Duration Index	55
CAIDI – Customer Average Interruption Duration Index	56
CEMI _n – Customers Experiencing Multiple Sustained Interruptions more than n	56
CEMSMI _n – Customers experiencing multiple sustained interruption and momentary interruption events	56
MED - Major Event Day	57
NUMBERS OF CUSTOMERS SERVED	58
Table 13.1 – Numbers of Customers Served	
ATTACHMENT 1 SAIDI AND SAISI HISTODICAL SUBBBADY	EO
ATTACHMENT 1 – SAIDI AND SAIFI HISTORICAL SUMMARY	58
COMPANY CONTACT	58

Introduction

Pursuant to WAC 480-100-398, Avista Corporation dba Avista Utilities ("Avista" or "the Company") submits its annual Electric Service Reliability Report. The report describes the Company's reliability monitoring and reliability metrics for 2011. All numbers included in this report are based on system-data. The Company's system includes 11 geographical divisions with two of those divisions overlapping the Washington and Idaho border leading to a commingling of jurisdictional customers. A map of Avista's operating area is included on page 54 of this report.

WAC 480-100-393 (3)(b) requires the establishment of baseline reliability statistics. The Company's baseline statistics are included in this report and compare the current year data to the baseline year of 2005 and years in between. The Company also provides a statistical target that represents an analysis based on an average over a time period and adding two standard deviations. Year to year variations should be below this target, but may provide information that shows continuing trends.

Avista has reported in its previous annual reports that the completion of the transition to the Outage Management Tool (OMT) system had caused an increase in the variability of the data collected from 2001 to 2007. The 2009 Annual Report (UE-100659) indicated that a gradual increase in the SAIFI and SAIDI numbers that cannot be attributed to the transition to the OMT system was occurring. This trend line is still showing a gradual increase but at a slower rate after including the 2011 data. The charts on pages 8 and 11 show a trend line for SAIFI and SAIDI historical data.

Continued scrutiny will be important over the next year or two to determine if the rate of increase for SAIFI/SAIDI continues to slow, due to the reliability improvement programs implemented in 2010, 2011, and currently underway in 2012.

The 2011 SAIFI and SAIDI reliability indices are slightly higher than the 2005 baseline, which may be due to the under reporting that may have occurred during the transition to OMT in 2005. On another note both the 2011 MAIFI and CAIDI reliability indices are below the 2005 baseline.

Avista added a new section beginning in the 2007 annual report (UE-080787) which analyzes the areas where customers are experiencing multiple sustained outages. This new section provides analysis of a reliability indice called $CEMI_n$, which implies Customers Experiencing Multiple sustained Interruptions more than n times.

Avista continues to review its annual baseline reliability statistics in light of operational experience under current regulatory protocol. Avista may modify its baseline statistics as appropriate and will update the Commission accordingly.

Definitions

"Reliability Statistic" – Standard Statistics measures and calculation methods are per the IEEE Standard 1366-2003 (or latest version) Titled "IEEE Guide for Electric Power Distribution Reliability Indices". Same as Reliability Indices.

"Major event" – Modified this definition to the IEEE Standard 1366-2003 (or latest version) of Major Event Day (MED), which uses a process "Beta Method" to identify a Major Event Day. The previous definition was "An event that impacts more than 5% of the Company's customers and causes outages of more than 24 hours in duration in any given division within its territory".

"Sustained Interruption" - An interruption lasting longer than 5 minutes.

"Momentary Event Interruption" – An interruption(s) of duration 5 minutes or less. Each event consists of one trip and one reclose operation that occur within 5 minutes. For example, if an interrupting device operates three times and then holds, this would be counted as three events with the number of customers affected as three times the Ni.

"Baseline reliability statistic" – Avista will compare its reliability statistics to the year 2005.

"Reliability Target" - A statistical method was developed in 2004 for baseline statistics. The method is defined as the average over a specific timeframe and 2 times the standard deviation. For 95% of the time, the Reliability Statistic should be below the target.

"Customer Complaint" - When a customer is not satisfied with the Company as it relates to Electric Reliability and makes a complaint directly to a Company representative.

"Commission Complaint" – When a customer is not satisfied with the Company as it relates to Electric Reliability and files a complaint directly with the Commission.

Data Collection and Calculation Changes

WAC 480-100-398 (2) requires the Company to report changes made in data collection or calculation of reliability information after initial baselines are set. This section addresses changes that the Company has made to data collection.

Data Collection

Since Avista's Electric Service Reliability Monitoring and Reporting Plan was filed in 2001 (UE-011428), there have been several improvements in the methods used to collect outage data. In late 2001, centralizing the distribution trouble dispatch and data collection function for Avista's entire service territory began. The distribution dispatch office is located in the Spokane main complex. At the end of September 2005, 100% of the Company's feeders, accounting for 100% of the customers, are served from offices that employ central dispatching.

The data collected for 2011 represents the fifth full year of outage data collected through the Outage Management Tool (OMT). For 2011, all data was collected using the "Outage Management Tool" (OMT) based on the Company's Geographic Information System (GIS). The OMT system automates the logging of restoration times and customer counts.

Avista discovered a software coding error that has been within the OMT system since 2002 that caused a small increase in the SAIDI and CAIDI for 2008. Previous years were also evaluated to determine the overall impact to the Avista baseline statistics and at this time Avista is not proposing a change to the baseline numbers. The software error only occurred during very specific outage conditions when a group of customers with an initial outage starting time were "rolled" up into another group of customers that were determined to be part of the first group outage. The second group may have had a later outage starting time. When the first group of customer outage information was rolled up, the original outage starting time was lost and the second group outage starting time was used for both groups of customers instead of using the first outage starting time. The number of customers was counted correctly.

Even as good as the OMT system is at quantifying the number of customers and duration of the outage duration, there still are areas where the data collection is not precise. Determining the exact starting time of an outage is dependent on when a customer calls in, how well the Avista Distribution Dispatcher determines where the outage is and defines the device that has opened to remove the faulted section.

As AMR/AMI metering is implemented in the future and the customer meter provides outage information to the OMT system through an interface, the SAIDI and CAIDI numbers are expected to increase. This is similar to the above discussion.

Use of the OMT system and GIS data has improved the tracking of the numbers of customers without power, allowed for better prioritization of the restoration of service, and the improved dispatching of crews.

Interruption Cause Codes

Cause code information is provided in this report to give readers a better understanding of outage sources. Further, the Company uses cause information to analyze past outages and, if possible, reduce the frequency and duration of future outages.

For 2011, Avista will stop using the subcategory "protected" under the "Animal" category. Almost all birds are considered protected, so there is little differentiation between the "Bird" and "Protected" subcategories. Avista will include additional information in the Remarks section as reported from the field personnel.

Customers Experiencing Multiple Interruptions

The IEEE Standard 1366P-2003 provides for two methods to analyze data associated with customers experiencing multiple momentary interruptions and/or sustained interruptions. Avista's Outage Management Tool (OMT) and Geographical Information System (GIS) provide the ability to geospatially associate an outage to individual customer service points. This association allows for graphically showing Customers Experiencing Multiple sustained Interruptions (CEMI_n) with Major Event Day data included onto GIS produced areas. Data can be exported to MS Excel to also create graphs representing different values of n. 2011 information is provided in the Customer Experiencing Multiple Interruptions (page 20) to summarize the analysis Avista performed on the 2011 outage data. The calculation for CEMI_n and Customers Experiencing Multiple Sustained and Momentary Interruptions CEMSMI_n is provided in the Indices Calculations section (page 55).

Major Events

Major Events and Major Event Days as used in this report are defined per the IEEE Guide for Electric Power Distribution Reliability Indices, IEEE P1366-2003. The following definitions are taken from this IEEE Guide.

Major Event – Designates an event that exceeds reasonable design and or operation limits of the electric power system. A Major Event includes at least one Major Event Day (MED).

Major Event Day – A day in which the daily system SAIDI exceeds a threshold value, T_{MED} . For the purposes of calculating daily system SAIDI, any interruption that spans multiple calendar days is accrued to the day on which the interruption began. Statistically, days having a daily system SAIDI greater than T_{MED} are days on which the energy delivery system experienced stresses beyond that normally expected (such as severe weather). Activities that occur on major event days should be separately analyzed and reported.

The Company will use the process defined in IEEE P1366 to calculate the threshold value of T_{MED} and to determine MED's. All indices will be reported both including and excluding MED's. The comparisons of service reliability to the baseline statistics in subsequent years will be made using the indices calculated without MED's.

Table 1.1 – 2011 Major Event Days

Major Event Days	SAIDI (Customer- Minutes)	Cause
2011 Major Event Day Threshold	10.848	
No MED		

No additional analysis of the 2011 Major Event Days is provided in this Annual Report as was done in previous years in the Major Event Day Causes section on page 50.

Customer Complaints

The Company tracks reliability complaints in two areas, Commission Complaints and Customer Complaints, which are defined in the Definitions section. See the Customer Complaints section on Page 34 for a summary of results for this year.

System Indices

The charts below show indices for Avista's Washington and Idaho ("system") electric service territory by year. Breakdown by division is included later in this report. Each chart shows seven years of data along with the baseline reliability statistic which is highlighted in green. The Company also has calculated a reliability target that is the average over the previous five years plus two standard deviations. This target is shown in yellow on the reliability indice charts.

The reliability targets have been adjusted by removing Major Event Days, MED's, as defined in the previous section.

Table 2.1 - Reliability Statistic Target by Indice

Indice	2005-2010 Average (Excluding Major Events)	2005 Baseline	Reliability Target (Ave + 2 Standard Deviations)
SAIFI	1.26	0.97	1.65
MAIFI	4.0	3.58	5.17
SAIDI	147	108	204
CAIDI	116	112	128

Additional comparisons of the Reliability Indices are provided in the Office Indices section (page 12) and Monthly Indices section (page 32) of this report.

The Company continues to use the definition of major events as described above to be consistent with IEEE Standards. Therefore, the following charts show statistics including the effect of major events per this definition. Both the Baseline Statistic is shown for the year 2005 (green bar), along with the Avista Target Statistic which is shown as the yellow bar.

Refer to Attachment 1 – SAIDI and SAIFI Historical Summary for additional historical information.

Chart 2.1 - SAIFI - Sustained Interruptions / Customer


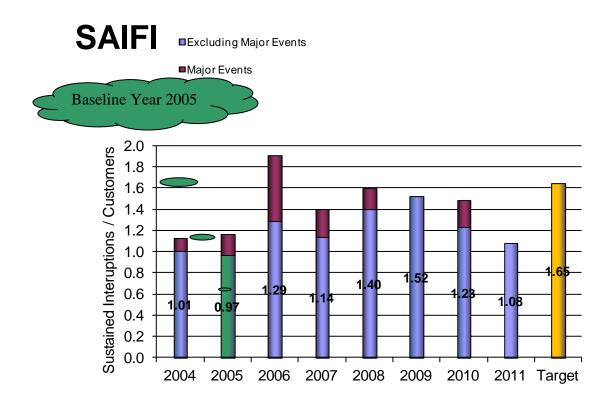


Chart 2.2 – Sustained Interruptions / Customer Historic Comparison

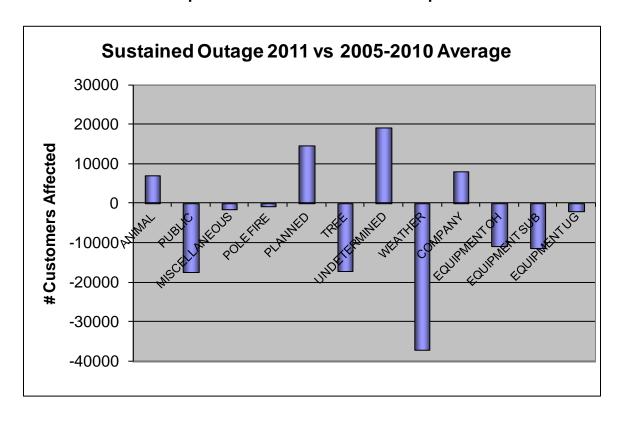

SAIFI for 2011 was slightly over the 2005 baseline statistic and does represent an increasing trend, but at a slower rate than previously reported in the 2010 Annual Report (UE-110787). The 2011 SAIFI number is lower than the two previous years and may represent decreases due to Company expenditures specifically targeting reliability. Using a simple linear regression to establish a trend line, it would look like about a 3.3% growth in the number of customers affected. The R² coefficient of determination shows a much weaker correlation to the data than last year. A chart of this analysis has been provided just after this discussion. Planned outages were a major contributor to the number of customers affected along with trees and substation equipment.

There were 56,460 customers affected by sustained outages caused by weather in 2011. This compares to the 2005–2010 average of 93,493 customers.

37,151 customers were affected by sustained outages associated with animal related incidents. This compares to the 2005-2010 average of 30,006 customers. The vast majority of the animal related reasons were associated with squirrel caused incidents.

Planned maintenance activities and forced repairs affected 50,524 customers as compared to the 2005-2010 average of 35,993 customers. Continued maintenance activities associated with the Company equipment replacement program contributed to the increase in this cause and reduced the Overhead Equipment outage causes.

Outages associated with Tree causes affected 40,743 customers as compared to the 2005–2010 average of 57,854.

Chart 2.3 - SAIFI Linear Trend Line Chart

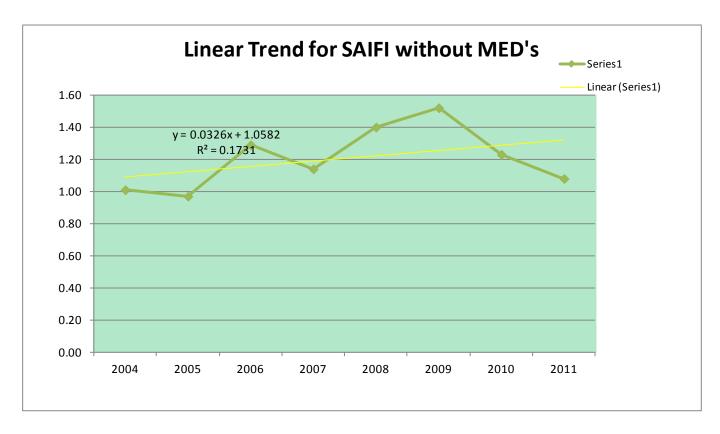


Chart 2.4 - MAIFI Momentary Interruption Events / Customer


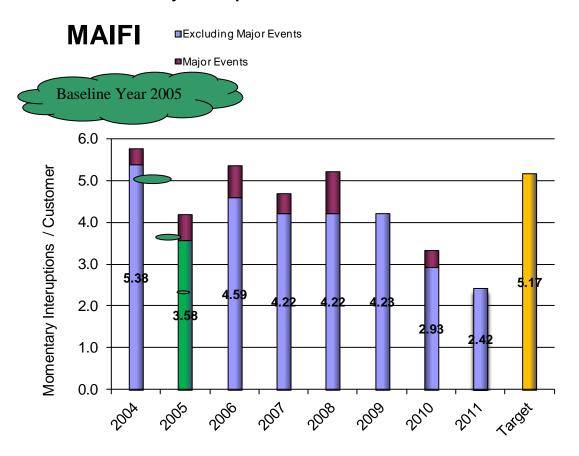


Chart 2.5 - Momentary Interruptions/ Customer Historic Comparison

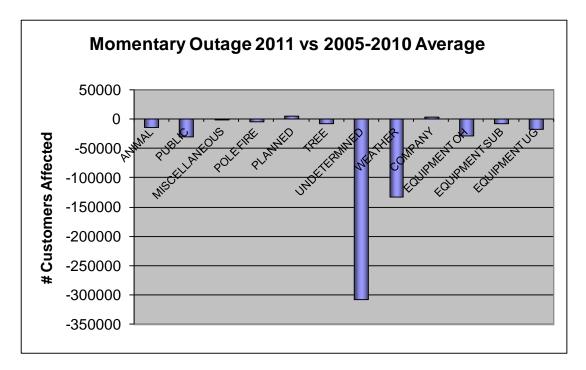

The 2011 results for MAIFI show a large decrease over both 2009 and 2010 data and also below the 2005 baseline year number. There was a reduction in weather related momentary outages that cannot be explained on weather conditions alone. There was a corresponding decrease in the number of undetermined outages, which can reflect that weather conditions did cause outages. The overall improvements in the MAIFI numbers may be due to tree trimming efforts along with Overhead Equipment replacement and Underground Equipment replacement. Some of the Urban areas have had the instantaneous trip function blocked, which reduces the total feeder customer momentary impacts, but may increase both SAIFI and SAIDI numbers for a few customers located downstream of a fuse lateral.

Distribution Dispatch continues to make improvements in correlating the momentary outages with subsequent sustained outages, which reduces the undetermined causes.

All other categories showed a slight decrease that would be consistent with previous years.

Chart 2.6 - SAIDI – Average Outage Time / Customer



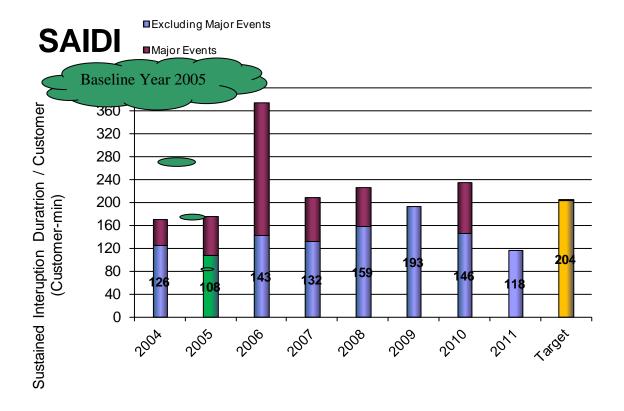


Chart 2.7 - SAIDI Linear Trend Line Chart



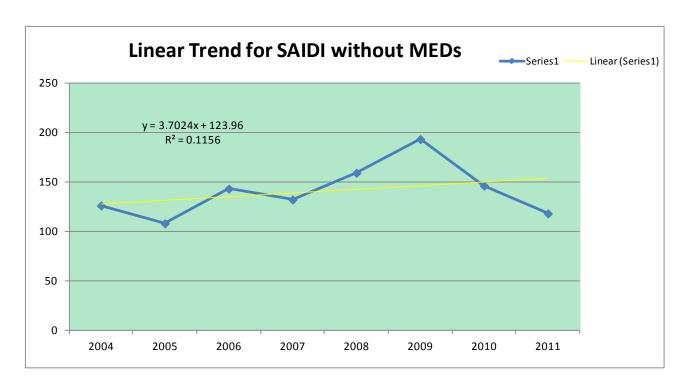

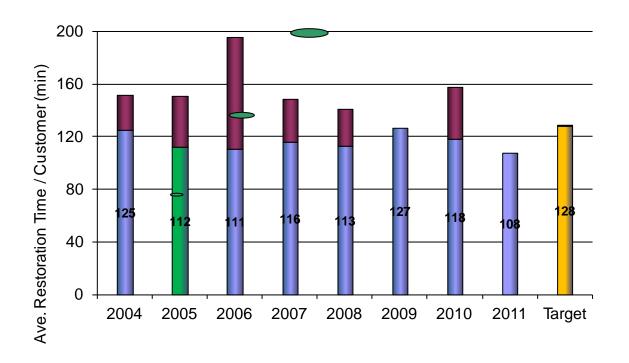

OFFICE Indices

Chart 3.1 - SAIFI - Sustained Interruptions / Customer

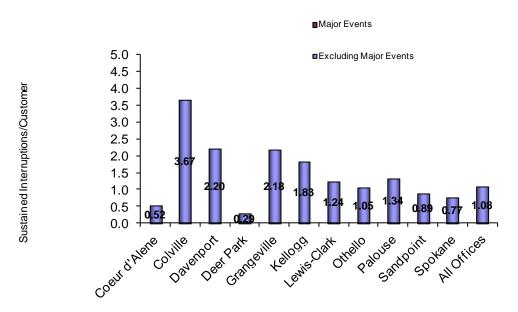


Chart 3.2 - MAIFI Momentary Interruption Events / Customer

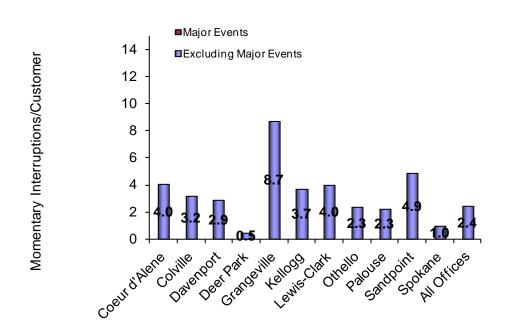


Chart 3.3 - SAIDI - Average Outage Time / Customer


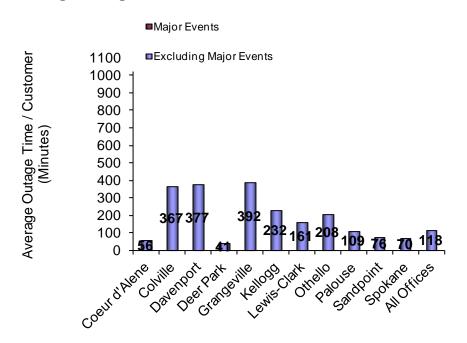


Chart 3.4 - CAIDI – Average Restoration Time

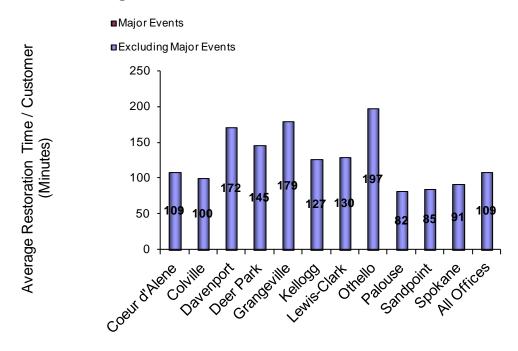

Areas of Concern

As in previous years, Colville continues to have the lowest reliability of Washington's operating areas. However, the Colville area continues to show improvement over previous years as work plans are implemented. Colville was judged lowest based on its performance in the yearly indices for SAIFI, SAIDI, CAIDI, and MAIFI. Within the Colville area, six feeders were identified as the Areas of Concern for 2011. These feeders are Gifford 34F1, Gifford 34F2, Colville 34F1, Chewelah 12F3, Chewelah 12F4, and Spirit 12F1. The first four feeders listed were also identified in the 2010 report (UE-110787) as Areas of Concern.

Cause Information

Generally rural areas have a greater number of outages per customer. Colville is a predominately rural and forested area. There are approximately 2,342 miles of distribution line exposed to weather, underground cable failures and tree problems. Unlike most of the Company's system, lines in this area are built on the narrow, cross-country rights-of-way, typical of PUD construction practices prior to Avista acquiring the system. These conditions make patrolling, tree trimming, rights-of-way clearing and other maintenance difficult. When cost effective, Avista moves sections of these overhead lines to road rights-of-way and/or converts them to underground.

Further, when outages occur in rural areas, the time required to repair damage is longer. More time is required for first responders to arrive and assess the damage and more time is required for the crew to reach the site. Often the damage is off road and additional time is required to transport materials and equipment to the site.

Listed below is a summary of the specific cause data for each feeder. This is a compilation of data from the Avista Outage Management Tool and the reporting from our local servicemen to Distribution Dispatch. Data from the reporting system is shown as a percentage of total customer-outages, (SAIFI) for that feeder.

Snow loading on green healthy trees growing beyond the rights-of-way often causes them to bend or break and contact distribution lines. These trees are not cut as part of our vegetation management program because they are outside our rights-of-way and are considered healthy marketable timber.

Gifford 34F1

- 36.0% Weather: snow, wind and lightning storms
- 3.5% Equipment
- 0.5% Public
- 11.1% Trees
- 34.8% Planned outages

Gifford 34F2

- 0.3% Weather: Wind, snow, and lightning storms
- 3.2% Equipment
- 2.8% Public
- 2.0% Trees
- 89.4% Planned outages
- 1.4.5% Animal: birds or squirrels

Colville 34F1

- 21.3% Weather; snow, wind and lightning storms
- 4.2% Equipment
- 38.8% Pole fires
- 23.7% Trees
- 4.8% Planned outages

Chewelah 12F3

- 7.1% Weather: snow, wind and lightning storms
- 24.0% Equipment
- 43.7% Pole fires
- 0.3% Trees
- 0.0% Planned outages

Chewelah 12F4

- 8.0% Weather: wind and lightning storms
- 20.5% Equipment
- 14.5% Pole fires
- 2.6% Trees
- 19.7% Planned outages

Spirit 12F1

- 0.6% Weather: snow, wind and lightning storms
- 39.0% Equipment
- 0.0% Pole Fire
- 20.2% Trees
- 27.3% Planned outages

Colville Area Work Plans

The improvement work that has been accomplished or planned for each feeder is listed below. The Company's reliability working group is continuing to study these feeders to develop additional work plans. Each of the identified feeders also had planned outages that correspond to the maintenance and replacement activities in the area.

Gifford 34F1

• No Vegetation Management work planned for 2012.

Gifford 34F2

- Due to Cultural review issues on some of the Tribal lands only 3,000 feet was replaced in 2010. Continued work and negotiations for the remaining 5,000 feet occurred in 2011, with final work to be completed in 2012.
- A reliability improvement project was planned for 2010 to convert 3.5 miles of 3-phase overhead line to URD in the Twin Lakes area near Inchelium. The plan was not implemented in 2010 due to Cultural review issues on the Tribal lands, but was completed overhead in 2011.
- Approximately 270 transformers on this circuit were equipped with a hot guard under the Wildlife Guard Program. This work was completed in 2011.
- Vegetation Management work planned for 2012 was re-prioritized to 2011 after circuit assessment showed a large number of dead or dying trees within radius of contact of our lines. Line clearance crews trimmed 651 trees and removed 867 trees in 2011. No work is planned for 2012.

Colville 34F1

- Vegetation Management crews were called to trim 3 trees and remove 59 trees as "unplanned" work on this circuit in 2011. A fall 2011 assessment of this circuit showed a significantly high mortality rate of trees within radius of contact of these lines. A line clearance crew began Risk Tree mitigation work on this circuit in February, 2012.
- \$100k was budgeted in 2011 to replace outage prone overhead sections with URD cable.
- \$62k was budgeted to install wild life guards in 2011. Approximately 65% of the CLV12F1 feeder was completed in 2011. Remaining work is budgeted for 2012.

Chewelah 12F3

• Vegetation Management completed 2,051 tree trims and 1,642 tree removals in 2010. As part of our planned maintenance cycle. This planned work was completed in early 2011 with an additional 169 trees were trimmed and 389 trees were removed No Vegetation Management work is planned for 2012.

In the Colville office area, there was \$649,999 spent for cable replacement in 2011 to replace 100,280 feet of problematic 15kV URD cable. There is \$352,000 budgeted for cable replacement in 2012

Table 4.1 - Colville Area Major Reliability Projects by Feeder

Feeder	Decisions/ basis	2012	2013 and Beyond
Gifford 34F1	Reliability improvements	No work planned.	No work planned in
			the next 5 years.
Gifford 34F2	Reliability improvements	Reconductor and	No work planned in
		replace recloser	the next 5 years.
Colville 34F1	Reliability improvements	No work planned.	No work planned in
			the next 5 years.
Chewelah 12F4	With the recent splitting of the		No work planned in
	Chewelah 12F3 feeder into two		the next 5 years.
	separate feeders, some additional	rs, some additional	
	monitoring needs to be done.		
Colville 12F2	Reliability improvements and voltage	Dollars are moved to	No work planned in
	drop improvement.	Gifford 34F2	the next 5 years.
SPI12F1	A major portion of this feeder will be	No work planned.	No work planned in
	reconductored for voltage drop		the next 5 years.
	improvement. Some additional		
	reliability improvement should be		
	done with this project.		
Orin 12F1	Reliability Improvements	No work planned.	Add recloser
Orin 12F3	Reliability Improvements	No work planned.	Add recloser

Table 4.2 - Colville Area Historical & Proposed Future Reliability Projects by Feeder

	Last	Proposed	Proposed			Veg Management	Wildlife Guards
Feeder	WPM	WPM	WPM	Transformer	Last Veg	Proposed	Proposed
Name	Inspection	Inspection	Follow-up	Change-outs	Management	Year	Year
		25% in	25% in	78 in 2012 or			
GIF34F1		2011	2012	2013	2009	2014	2013
				50 in 2014,			
GIF34F2	1995			2015, or 2016	2006	2011	2011
				42 in 2014,			
CHW12F3	1997			2015, or 2016	2011	2013	
				28 in 2014,			
CHW12F4	1997			2015, or 2016	2011	2016	
				39 in 2014,			
CLV34F1	1999			2015, or 2016	2007	2012	2011
				37 in 2014,			
VAL12F3	1998			2015, or 2016	2010	2015	
SPI12F1	1194			42 in 2014	2011	2016	

Avista System Wide Work Plans


Avista develops a detailed annual budget for various improvements to the facilities it owns and operates. For 2011, several reliability feeder projects were completed and described above. The reliability improvement should show up over the next couple of years. Valley 12F1 and Valley 12F3 have improved reliability enough to be removed from the Area of Concern list in 2011. Additionally Asset Management has developed some specific projects that are expected to improve reliability on several feeders system wide. These projects are summarized in the table above.

Material records show that some wildlife guards were installed on new distribution transformers installations starting in the mid 1980's. With the recognition of increases in animal caused outages, new materials and improvements have been made in the construction standards for new distribution transformer installations to reduce these types of outages. Initial indications show that the outage reduction on a feeder after wildlife guards are installed is significant.


2009 was the start of the multiyear wildlife guard installation program to reduce the squirrel and bird related outages on approximately sixty feeders in Washington and Idaho. Most of the wildlife guards were installed with a hot stick on existing transformers that do not have an existing wildlife guard.

Avista installed a total of 1,060 wildlife guards on 7 feeders in 2011. There were 449 wildlife guards installed in Idaho on three feeders and 611 wildlife guards installed in Washington on four feeders. The chart below shows the effectiveness of the wildlife guard program in reducing squirrel related outages.



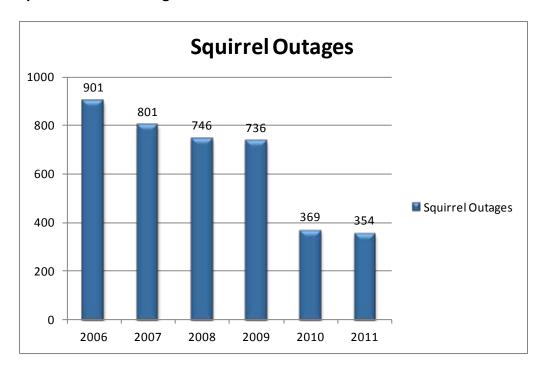

Asset Management in conjunction with the Wood Pole Management Program over the last three years has stubbed/reinforced or replaced numerous poles, replaced numerous pole top transformers and associated cutouts/arresters. Below is a chart that summarizes the Wood Pole Management activities.

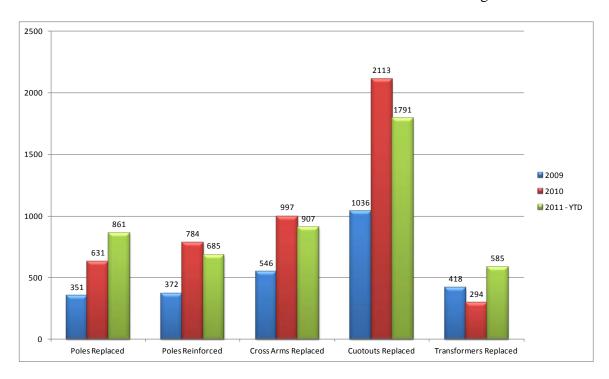

Avista System Wide Vegetation Management Plan

Avista has an annual vegetation management plan and budget to accomplish the plan. The budget is allocated into distribution, transmission, administration, and gas line re-clearing.

Distribution

Avista's distribution system is now managed by Avista's new Utility Arborist. Every distribution circuit is now scheduled to be line clearance pruned on a regular maintenance cycle of five years. Recent changes to the program are designed to help identify risk trees system wide every two years. These changes include:

- Improved mid-cycle (two to three years after planned maintenance work is completed) Risk Tree assessment and mitigation on circuits in our more heavily vegetated areas (such as the Colville Division).
- Expanded herbicide program to assess and address needed work on each circuit over a five year cycle (three years after line clearance work performed).

Transmission

The transmission system is managed by Avista's forester. All 230 kV lines are patrolled annually for hazard trees and other issues, and mitigation is done in that same year. Approximately one third of the 115 kV transmission system is patrolled annually for hazard tree identification and assessment of right-of-way clearing needs. Right-of-way clearing maintenance is scheduled and performed approximately every ten to fifteen years (for each line). Interim spot work is done as identified and needed. Engineering specifications for various voltages, line configurations are followed when clearing the right-of-way. Currently, the work is bid to a variety of contractors.

Customers Experiencing Multiple Interruptions

Avista has used the data from the OMT system integrated with the GIS system to geospatially display reliability data for specific conditions. The specific conditions imply looking at the number of sustained interruptions for each service point (meter point). This would be similar to the SAIFI indice, but would be related to a certain number of sustained interruptions. Avista includes all sustained interruptions including those classified under Major Event Days. This provides a view of what each customer on a specific feeder experiences on an annual basis. Momentary Interruptions are not included in the CEMI $_n$ indice because by IEEE definition is only applies to sustained outages. Other Momentary Indices are not included because of the lack of indication at many rural substations and line locations.

The first chart below provides a view of the percentage of customers served from the Avista system that have sustained interruptions. 74 % of Avista customers had one or fewer sustained interruptions and 2.6% of Avista customers had six or more sustained interruptions during 2011.

The remaining geographic plots show the sustained interruptions by color designation according to the legend on each plot for each office area. Note the office area is designated as the area in white for each plot and that there is overlap between adjacent office area plots. The adjacent office areas are shown in light yellow.

The plots provide a quick visual indication of varying sustained interruptions, but significant additional analysis is required to determine underlying cause(s) of the interruptions and potential mitigation.

Chart 5.1 - Avista Service Territory - CEMIn

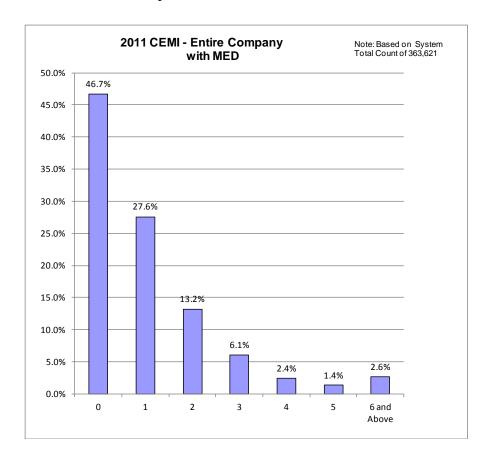


Chart 5.2 - Colville Office - CEMIn

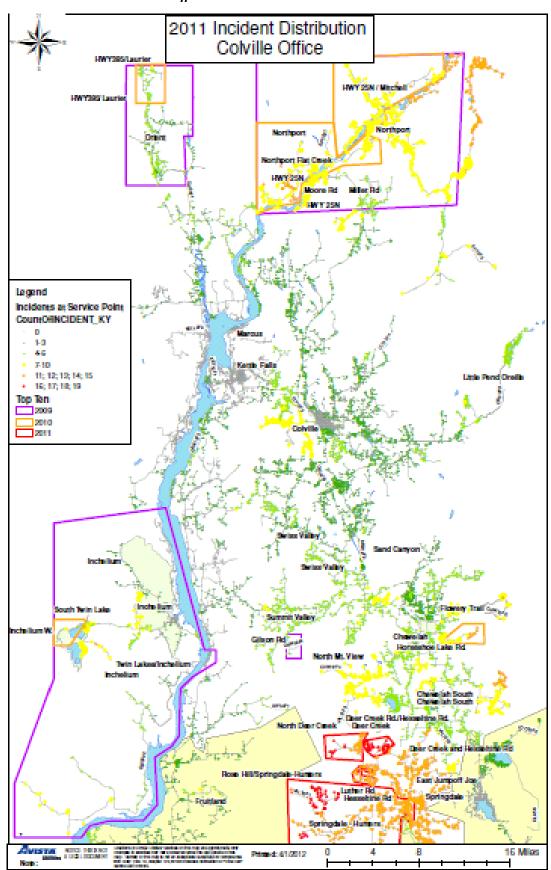


Chart 5.3 - Davenport Office - CEMIn

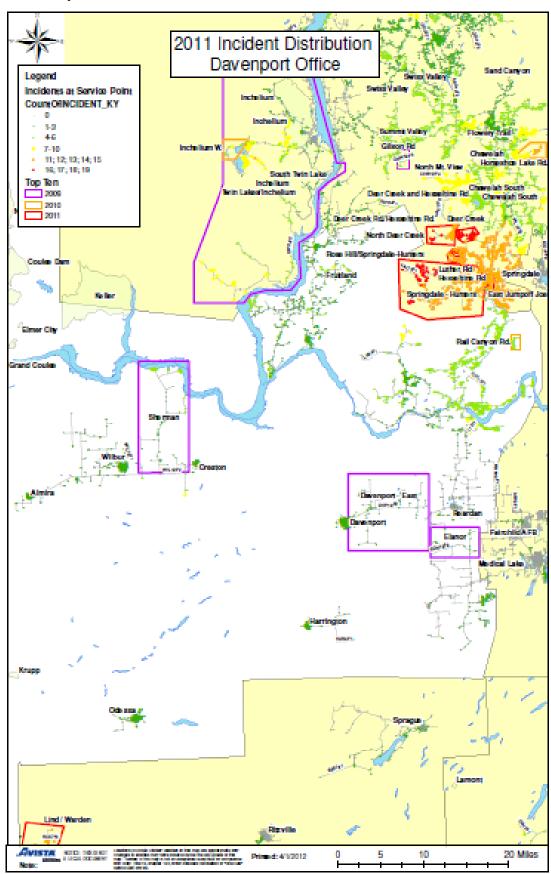


Chart 5.4 - Deer Park Office - $CEMI_n$

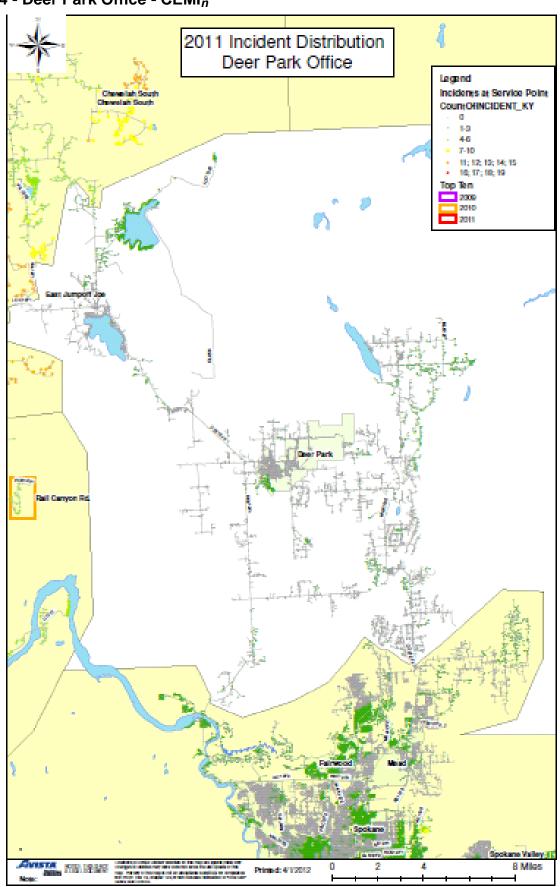


Chart 5.5 - Othello Office - CEMI_n

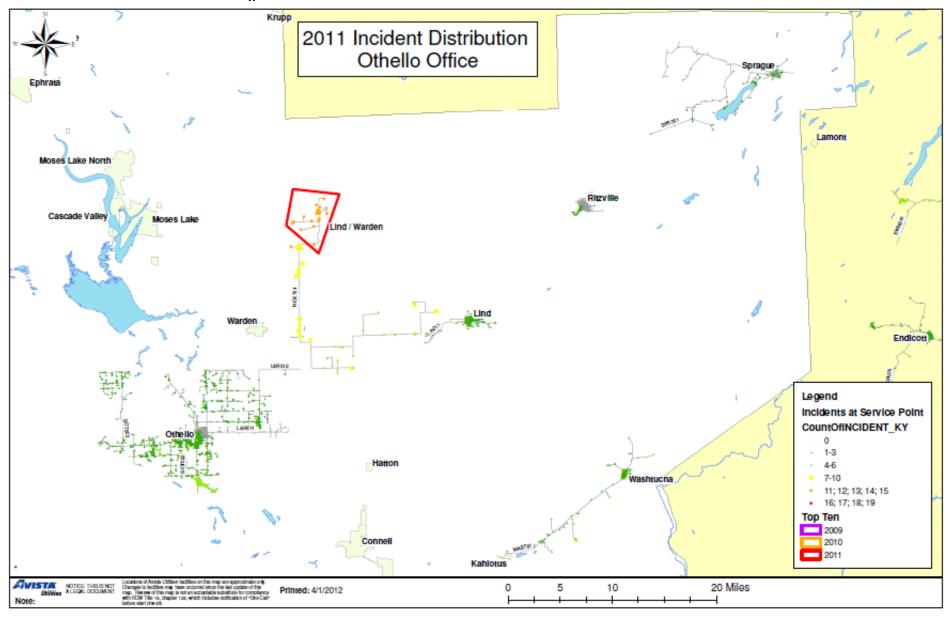


Chart 5.6 - Palouse Office - CEMIn

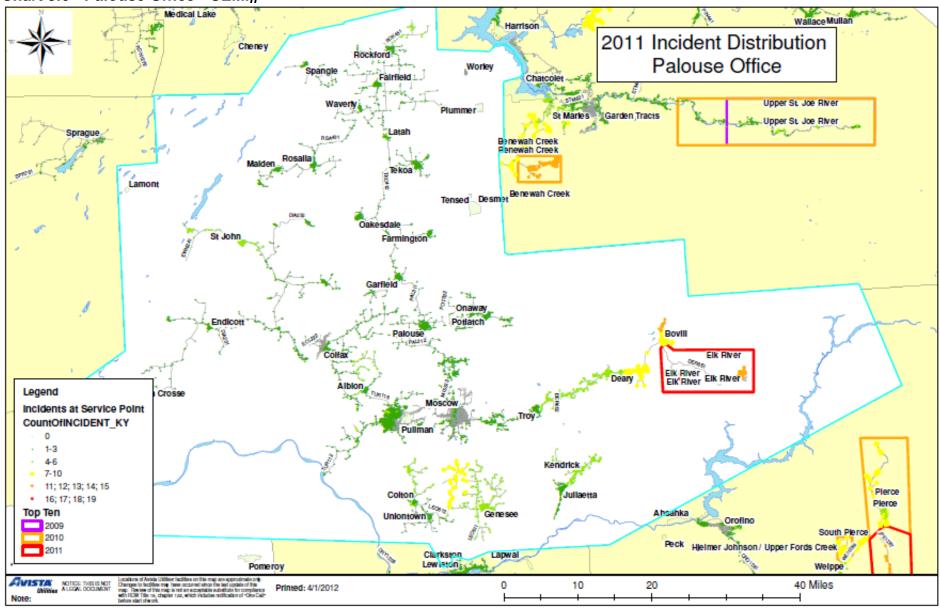


Chart 5.7 - Lewis-Clark Office - CEMI_n

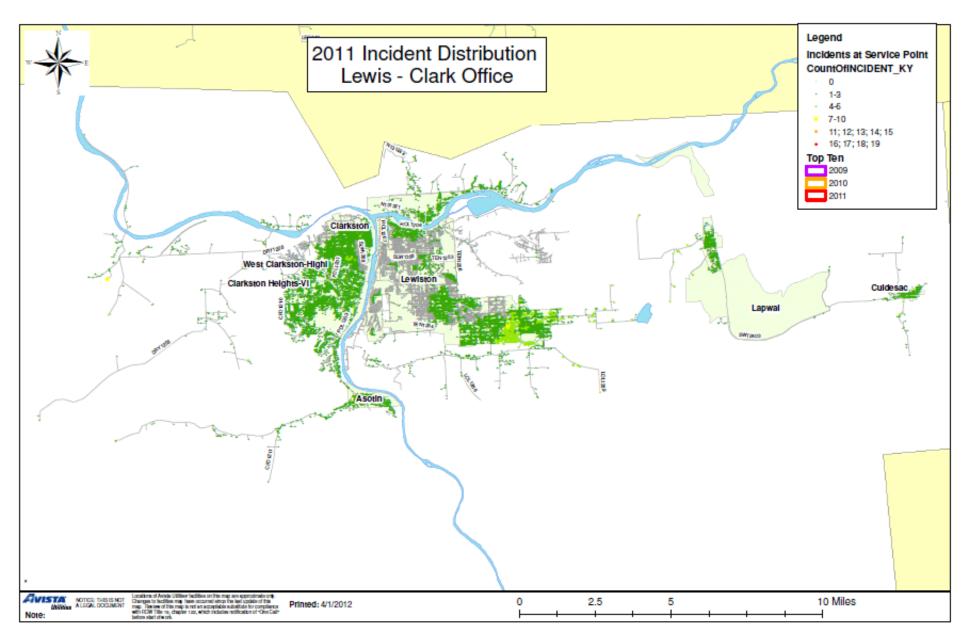


Chart 5.8 - Spokane Office - CEMIn

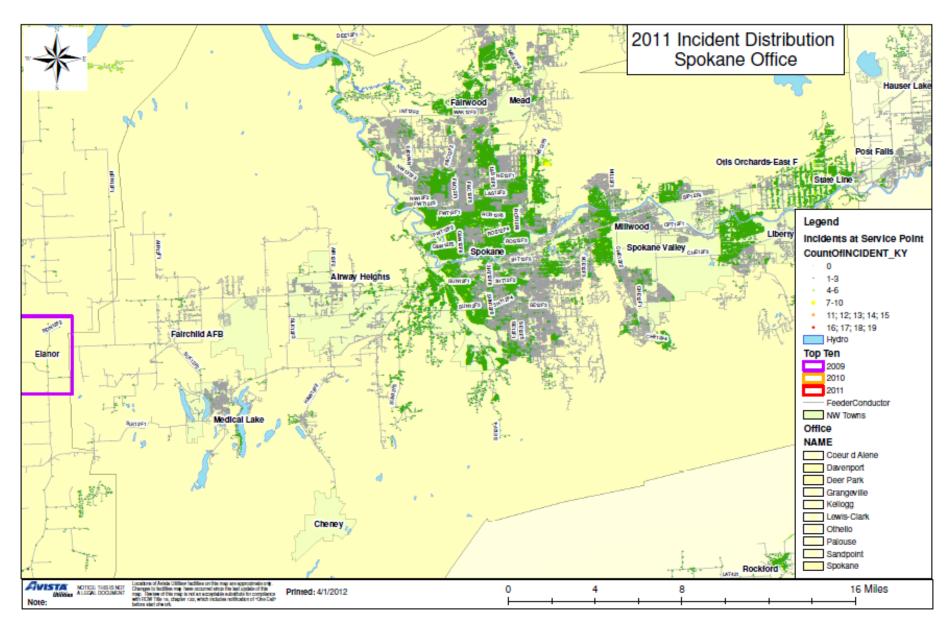


Chart 5.9 - Sandpoint Office - CEMIn

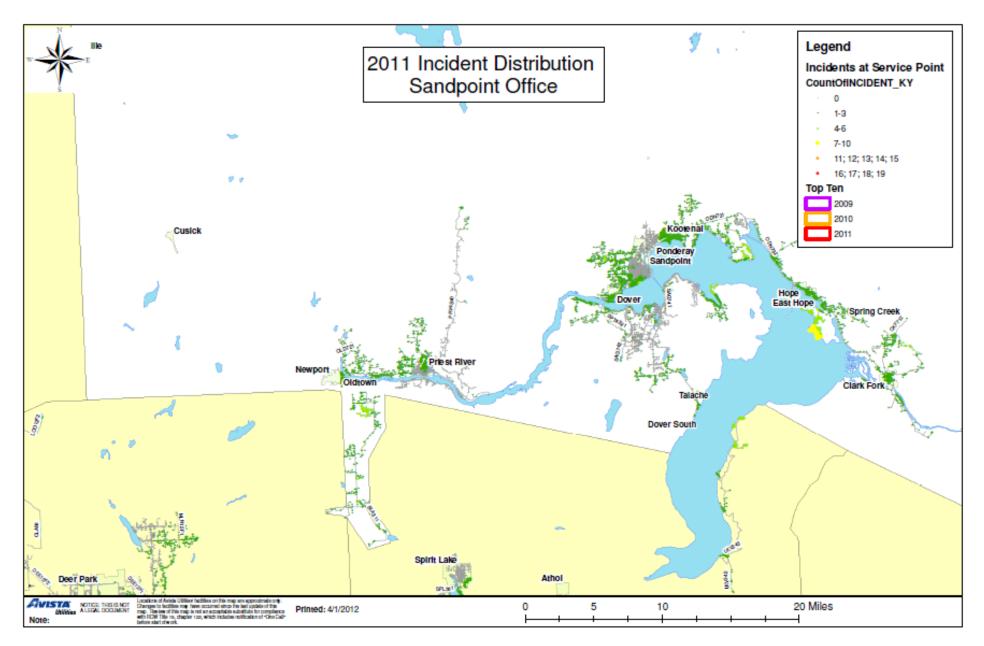


Chart 5.10 - Kellogg Office - CEMIn

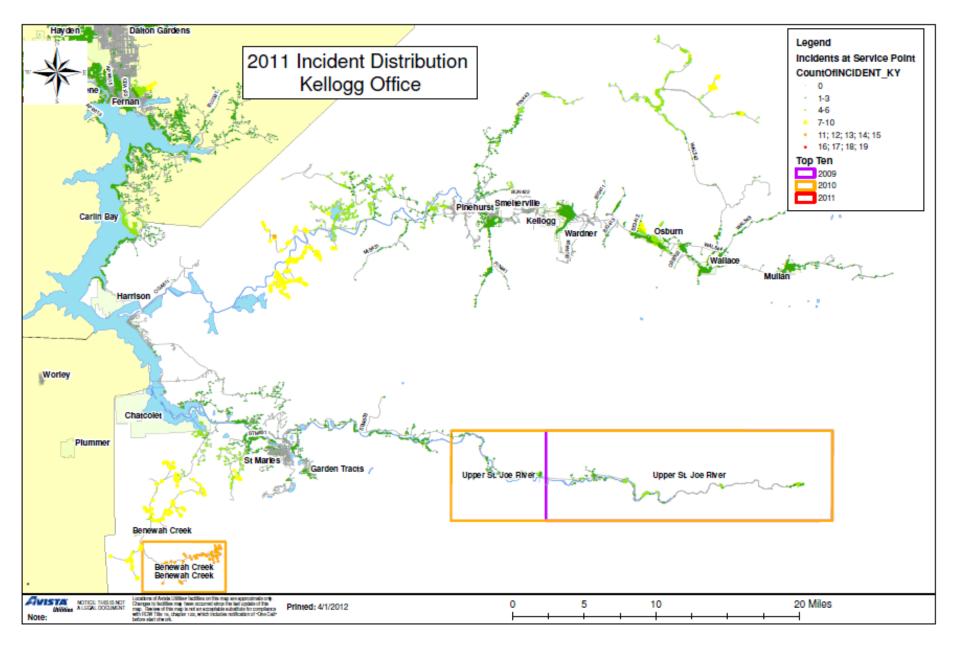


Chart 5.11 - Coeur d'Alene - CEMI_n


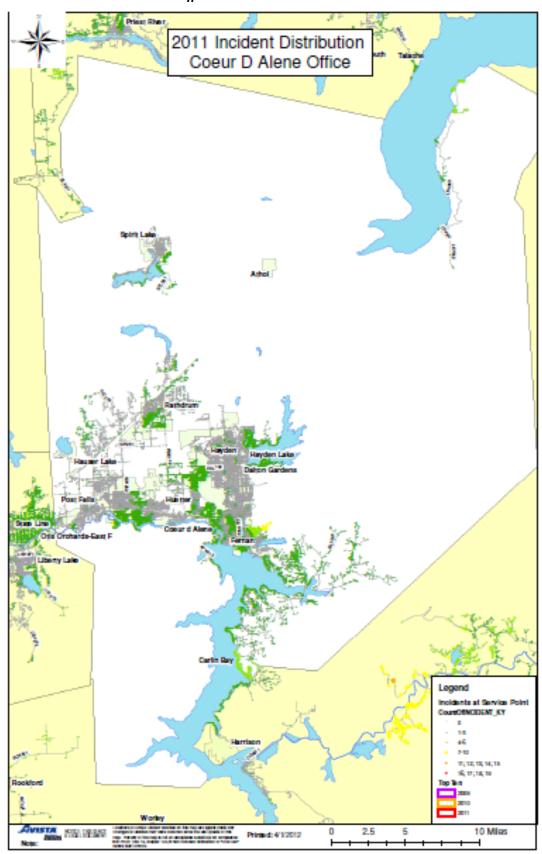


Chart 5.12 - Grangeville Office - CEMIn

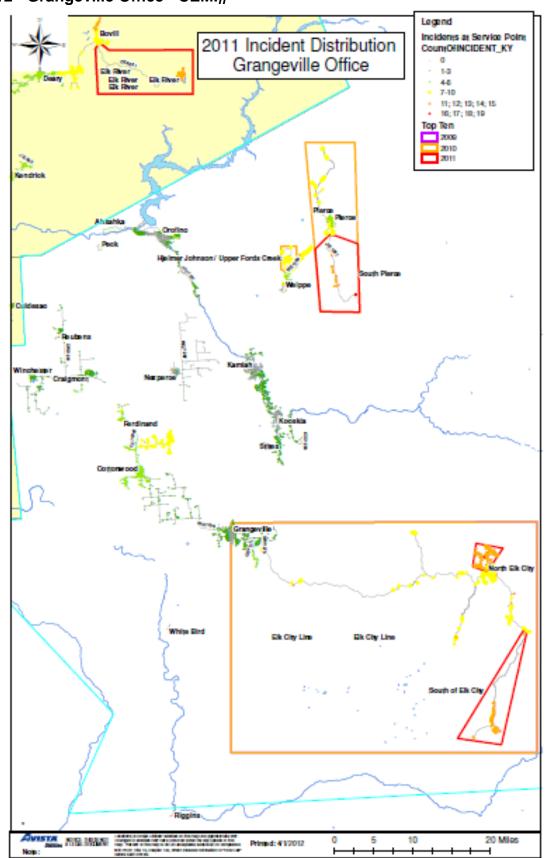

Monthly Indices

Each of the following indices, reported by month, shows the variations from month to month. These variations are partially due to inclement weather and, in some cases, reflect incidents of winter snowstorms, seasonal windstorms, and mid- and late summer lightning storms. They also reflect varying degrees of animal activity causing disruptions in different months of the year.

Chart 6.1 - SAIFI - Sustained Interruptions / Customer

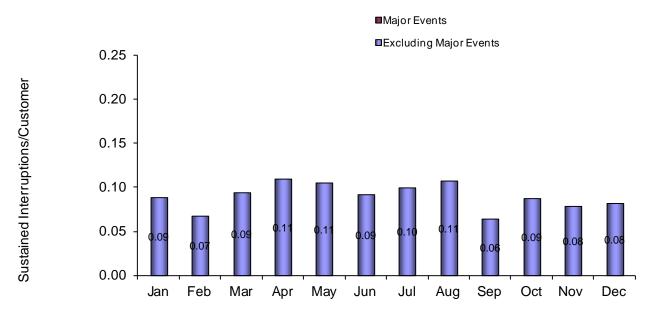


Chart 6.2 - MAIFI Momentary Interruption Events / Customer

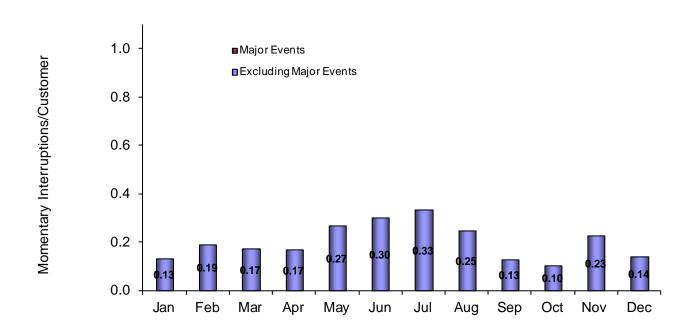


Chart 6.3 - SAIDI - Average Outage Time / Customer


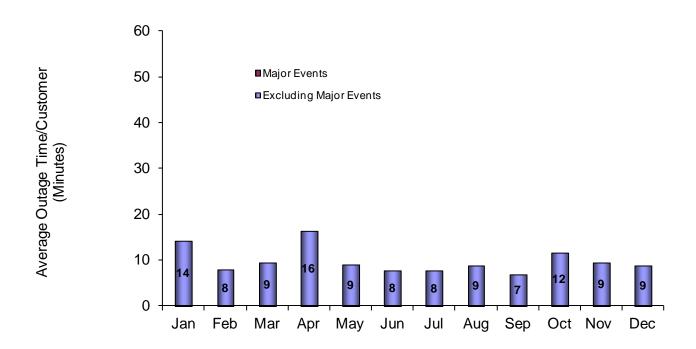


Chart 6.4 - CAIDI - Average Restoration Time

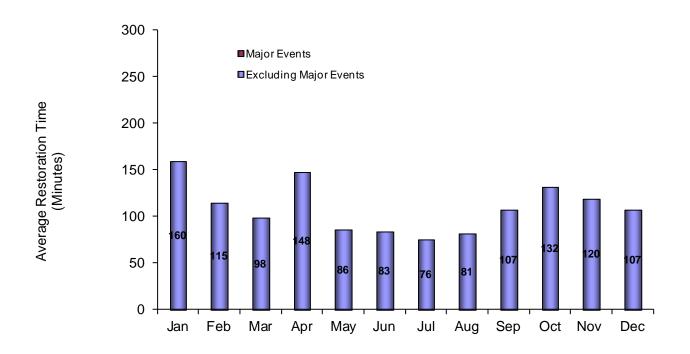

Customer Complaints

Table 7.1 - Commission Complaints

The following is a list of Complaints made to the Commission during 2011.

Customer	Complaint	Complaint	Resolution
Address	•	Category	
Colville, WA	Customer states there are too many	Outages	Avista reported there were 10 outages between 7/13/09 and 06/13/11.
	outages- has a computer UPS that		There were 4 outages in 2011.
Orin 12F3	logged 10 outages between 09 and		One Momentary Outage
	Jan 11. Customer was told by an		2/25/11 0:10 Undetermined
Complaint	Avista representative that this is		1/28/11 0:11 Planned Outage – repair regulator
#110716	normal due to snow conditions.		5/16/11 0:54 Pole Fire
	Customer sent complaint to WUTC		6/13/11 3:18 Weather Outage
	and asked if this is true? Wants to		
	know what Avista is doing to		Avista responded with a lengthy explanation concerning the Customer
	improve reliability.		recorded outages compared to the Company recorded outages. Customer
			was satisfied with the explanation and the complaint was closed.
Nine Mile	Customer experienced an 8 hour	Outages	Avista reported that there have been 6 outages in 2011 that affected this
Falls, WA	power outage on 12/13. Customer		customer.
	said he tried to contact the company		5/16/11 0:54 Fire on Transmission pole
Long Lake	and received a recording that told		7/22/11 3:06 Not a system problem – Power on when serviceman arrived
12F1	him his power was out but did not		at Customer location.
	say why. He was told the power		8/29/11 0:45 Equipment Overhead
Complaint	would be back on around 10 PM		10/10/11 0:33 Animal
#290128268	and it did not come back until		11/17/11 3:50 Equipment Overhead
	around 3 AM. Customer would like		12/13/11 7:37 Undetermined Outage
	to know why his power was out so		
	long. Why he has experienced so		
	many power outages (including		
	blinking outages) and what the		
	Company is doing to fix the		
	problem.		

Table 7.2 - Customer Complaints

The following is a list of complaints made to our Customer Service Representatives.

Customer / Feeder	Complaint	Complaint Category	Resolution
Clarkston, WA PDL1204/CFD1210	Two Customers called that were neighbors stating they are constantly having power surges here. Avista customer representative stated these were trip and recloses on the feeder. Dispatch said they also had one that morning.	Outages	There were 4 Momentary interruptions and 5 Sustained Outages in 2011. No Resolution Documented. This is two separate customer complaints combined.
Coeur d Alene, ID CDA123	Customer called and was upset about the Electric Service Quality and specifically the number of outages. Customer feels Avista is not keeping the trees cleared from distribution lines like they should be and with winter comings thinks it will get worse. Recent outage dates of 11/2/11 and 10/31/11.	Outages	There were 13 Momentary interruptions and 10 Sustained Outages in 2011. No Resolution Documented.
Springdale, WA FOR12F1	Customer feels Avista is not repairing properly since there are frequent outages here since 9/2010. Customer says outages originate at same place and has not had this many outages in such a short time frame before.	Outages	There were no Momentary interruptions documented and 6 Sustained Outages in 2011. No Resolution Documented.
Weippe, ID WEI1289	Customer upset that the power keeps going out and is also flickering. Avista just keeps patching the lines and said the weight of repairs affecting lines.	Outages	There were 13 Momentary interruptions and 8 Sustained Outages in 2011. No Resolution Documented.

Sustained Interruption Causes

Table 8.1 - % SAIFI per Cause by Office

The following table lists the percentage SAIFI contribution by causes for outages excluding major event days.

Reason	CDC	COC	DAC	GRC	KEC	LCC	ОТС	PAC	SAC	SPC	DPC	All Offices
ANIMAL	19.6%	7.6%	8.1%	0.6%	3.5%	21.9%	2.0%	2.1%	6.0%	11.7%	2.0%	9.5%
MISCELLANEOUS	0.0%	0.0%	3.9%	0.0%	0.0%	0.0%	0.0%	0.0%	3.0%	0.0%	0.0%	0.3%
POLE FIRE	2.4%	11.3%	21.5%	6.7%	7.7%	9.6%	3.7%	5.6%	4.0%	6.8%	0.4%	7.8%
WEATHER	2.1%	8.6%	11.1%	38.0%	28.8%	4.5%	5.2%	15.4%	6.4%	17.0%	10.5%	14.4%
UNDETERMINED	18.9%	24.9%	8.9%	4.3%	15.5%	8.3%	46.1%	32.8%	41.9%	11.0%	37.0%	18.2%
TREE	7.1%	9.7%	1.2%	15.2%	22.2%	18.3%	0.1%	17.1%	18.0%	3.9%	9.0%	10.4%
PUBLIC	5.7%	1.6%	3.7%	4.5%	6.2%	8.2%	15.7%	6.6%	4.0%	9.8%	10.8%	6.7%
COMPANY	13.4%	1.6%	10.9%	0.0%	0.0%	0.0%	3.6%	5.5%	0.0%	13.2%	0.1%	6.6%
EQUIPMENT OH	6.1%	16.2%	18.6%	14.9%	5.1%	4.1%	14.8%	3.8%	5.9%	10.4%	8.6%	9.8%
EQUIPMENT UG	6.1%	0.8%	0.1%	0.8%	0.4%	0.5%	0.3%	1.0%	0.5%	0.6%	6.2%	1.1%
EQUIPMENT SUB	8.1%	0.0%	0.0%	0.0%	4.2%	18.8%	0.0%	0.0%	0.0%	0.0%	0.0%	2.6%
PLANNED	10.4%	17.7%	12.0%	14.9%	6.5%	6.0%	8.6%	10.1%	10.3%	15.4%	15.5%	12.9%

CDC	Coeur d'Alene	LCC	Lewiston-Clarkston
COC	Colville	OTC	Othello
DAC	Davenport	PAC	Palouse
DPC	Deer Park	SAC	Sandpoint
GRC	Grangeville	SPC	Spokane
KEC	Kellogg/ St. Maries		

Chart 8.1 - % SAIFI per Cause by Office

The following chart shows the percentage SAIFI contribution by causes for outages excluding major event days.

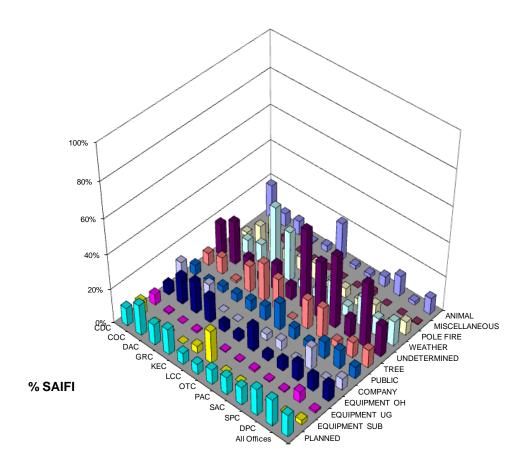


Table 8.2 - % SAIDI per Cause by Office

The following table lists the percentage SAIDI contribution by causes for outages excluding major event days.

Reason	CDC	COC	DAC	GRC	KEC	LCC	отс	PAC	SAC	SPC	DPC	All Offices
ANIMAL	10.3%	3.7%	2.5%	0.4%	3.7%	15.2%	1.1%	2.5%	5.0%	9.6%	1.5%	6.4%
MISCELLANEOUS	0.0%	0.0%	0.9%	0.0%	0.0%	0.0%	0.0%	0.0%	1.7%	0.0%	0.0%	0.1%
POLE FIRE	3.9%	13.4%	4.3%	3.3%	4.2%	5.8%	7.2%	6.0%	7.5%	7.3%	1.2%	6.9%
WEATHER	5.3%	16.0%	33.7%	41.7%	36.3%	2.3%	5.3%	28.1%	13.1%	30.3%	8.6%	23.3%
UNDETERMINED	4.5%	10.8%	7.6%	1.8%	7.3%	4.5%	45.7%	15.7%	8.8%	6.1%	42.8%	9.0%
TREE	32.3%	14.2%	1.3%	13.1%	28.4%	15.3%	0.1%	15.6%	36.0%	5.5%	6.3%	13.6%
PUBLIC	8.5%	2.4%	5.4%	6.4%	5.5%	4.2%	22.9%	9.9%	8.4%	9.6%	10.5%	7.4%
COMPANY	2.4%	0.3%	1.9%	0.0%	0.0%	0.0%	1.6%	0.6%	0.0%	2.7%	0.1%	1.2%
EQUIPMENT OH	6.4%	17.1%	14.9%	15.7%	6.6%	2.6%	6.1%	4.8%	11.0%	11.7%	5.0%	10.4%
EQUIPMENT UG	11.3%	0.5%	0.3%	1.7%	0.9%	0.8%	0.2%	4.0%	1.2%	1.8%	7.4%	2.1%
EQUIPMENT SUB	7.9%	0.0%	0.0%	0.0%	1.6%	40.6%	0.0%	0.0%	0.0%	0.0%	0.0%	5.1%
PLANNED	7.4%	21.7%	27.0%	15.8%	5.5%	8.8%	9.8%	12.6%	7.3%	15.5%	16.6%	14.5%

CDC	Coeur d'Alene	LCC	Lewiston-Clarkston
COC	Colville	OTC	Othello
DAC	Davenport	PAC	Palouse
DPC	Deer Park	SAC	Sandpoint
GRC	Grangeville	SPC	Spokane
KEC	Kellogg/ St. Maries		_

Chart 8.2 - % SAIDI per Cause by Office

The following chart shows the percentage SAIDI contribution by causes for outages excluding major event days.

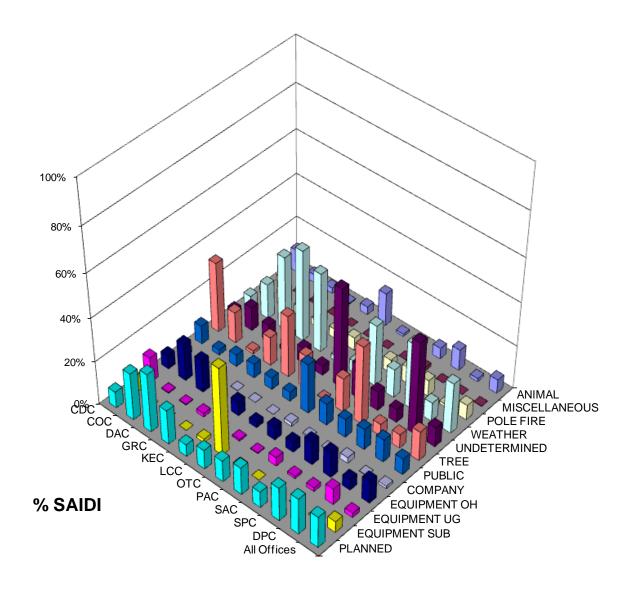


Table 8.3 - % SAIFI per Cause by Month

The following table lists the percentage SAIFI contribution by causes for all outages, excluding major event days.

Reason	Jan	Feb	Mar	Apr	May	June	July	Aug	Sept	Oct	Nov	Dec	Yearly
ANIMAL	0.5%	2.4%	0.8%	28.8%	2.8%	27.2%	9.6%	9.1%	2.8%	19.3%	0.8%	0.9%	9.5%
MISCELLANEOUS	0.0%	0.0%	0.0%	0.0%	1.5%	0.0%	0.0%	0.0%	1.7%	0.0%	0.0%	0.1%	0.3%
POLE FIRE	1.1%	0.2%	5.7%	0.3%	20.3%	0.1%	19.0%	1.9%	19.3%	20.4%	5.3%	0.3%	7.8%
WEATHER	18.2%	12.0%	18.9%	30.6%	12.8%	19.1%	13.5%	3.0%	0.4%	0.3%	11.4%	26.5%	14.4%
UNDETERMINED	33.9%	7.9%	11.7%	4.3%	39.0%	6.9%	17.2%	15.7%	14.8%	17.6%	29.5%	18.9%	18.2%
TREE	6.5%	14.8%	19.2%	4.9%	9.5%	6.0%	13.9%	2.3%	12.1%	5.0%	29.4%	6.2%	10.4%
PUBLIC	5.8%	28.7%	3.5%	6.6%	2.0%	6.5%	6.6%	5.1%	8.2%	6.6%	4.5%	3.0%	6.7%
COMPANY	0.1%	0.0%	22.2%	5.7%	0.0%	5.7%	6.2%	12.0%	17.0%	0.0%	0.5%	9.9%	6.6%
EQUIPMENT OH	12.0%	11.4%	4.2%	6.0%	2.9%	12.5%	3.8%	31.0%	2.5%	11.7%	9.8%	6.4%	9.8%
EQUIPMENT UG	0.2%	0.6%	0.5%	0.6%	1.1%	0.8%	0.3%	4.2%	1.2%	0.8%	0.2%	1.6%	1.1%
EQUIPMENT SUB	11.2%	13.0%	0.0%	0.0%	0.5%	0.0%	0.0%	5.0%	0.0%	3.4%	0.0%	0.0%	2.6%
PLANNED	10.5%	8.9%	13.2%	12.3%	7.6%	15.2%	9.8%	10.6%	20.0%	14.9%	8.6%	26.1%	12.9%

Chart 8.3 – % SAIFI per Cause by Month

The following chart shows the percentage SAIFI contribution by causes for all outages, excluding major event days.

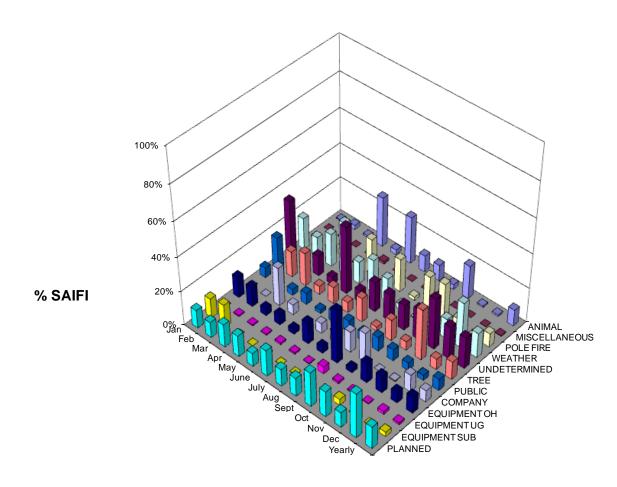


Table 8.4 - % SAIDI per Cause by Month

The following table lists the percentage SAIDI contribution by causes for outages excluding major event days.


REASON	Jan	Feb	Mar	Apr	May	June	Jul	Aug	Sept	Oct	Nov	Dec	Yearly
ANIMAL	0.5%	3.6%	0.9%	15.5%	3.9%	20.6%	13.3%	6.7%	2.6%	6.4%	0.5%	0.7%	6.4%
MISCELLANEOUS	0.0%	0.0%	0.0%	0.0%	0.7%	0.0%	0.0%	0.0%	0.7%	0.0%	0.0%	0.0%	0.1%
POLE FIRE	0.9%	0.2%	10.8%	0.3%	11.8%	0.6%	14.4%	1.0%	22.8%	16.9%	9.8%	1.3%	6.9%
WEATHER	21.9%	13.7%	29.2%	55.5%	35.3%	15.9%	18.7%	7.0%	0.7%	0.3%	14.7%	40.5%	23.3%
UNDETERMINED	18.2%	1.1%	5.0%	2.3%	6.2%	8.9%	10.4%	5.2%	15.5%	10.8%	11.5%	13.3%	9.0%
TREE	5.0%	35.5%	16.8%	3.0%	19.7%	14.0%	16.7%	3.6%	9.1%	10.2%	35.0%	9.6%	13.6%
PUBLIC	7.6%	12.3%	8.6%	6.9%	2.9%	7.1%	4.9%	6.6%	13.5%	7.2%	8.6%	4.3%	7.4%
COMPANY	0.1%	0.0%	2.9%	0.3%	0.0%	2.1%	0.9%	2.0%	7.8%	0.0%	0.3%	0.5%	1.2%
EQUIPMENT OH	13.2%	11.3%	7.6%	4.0%	4.8%	11.7%	7.2%	32.2%	5.5%	10.5%	10.8%	8.9%	10.4%
EQUIPMENT UG	0.2%	1.0%	1.3%	1.1%	3.2%	1.7%	0.9%	12.2%	3.0%	2.0%	0.4%	0.9%	2.1%
EQUIPMENT SUB	28.0%	16.5%	0.0%	0.0%	2.1%	0.0%	0.0%	4.9%	0.0%	1.3%	0.0%	0.0%	5.1%
PLANNED	4.3%	4.9%	16.9%	11.1%	9.3%	17.4%	12.7%	18.6%	18.8%	34.4%	8.4%	20.0%	14.5%

Table 8.4.1 Average Outage Time (HH:MM)

Reason	Jan	Feb	Mar	Apr	May	June	July	Aug	Sept	Oct	Nov	Dec	Yearly
ANIMAL	2:34	2:49	1:49	1:19	2:00	1:03	1:45	0:59	1:40	0:43	1:18	1:17	1:13
COMPANY	1:32	0:00	0:13	0:07	2:27	0:31	0:10	0:13	0:49	1:58	1:17	0:05	0:19
EQUIPMENT OH	2:56	1:54	2:57	1:39	2:21	1:18	2:22	1:24	3:53	1:58	2:11	2:28	1:55
EQUIPMENT SUB	6:39	2:26	0:00	0:00	6:07	4:02	0:00	1:20	0:00	0:49	0:00	0:00	3:38
EQUIPMENT UG	2:19	3:15	4:10	4:29	4:13	2:45	3:24	3:56	4:25	5:37	3:52	0:58	3:39
MISCELLANEOUS	0:00	1:29	0:00	0:00	0:41	0:00	0:00	0:00	0:48	0:00	1:59	0:24	0:43
PLANNED	1:06	1:03	2:05	2:14	1:45	1:35	1:37	2:22	1:40	5:04	1:56	1:21	2:02
POLE FIRE	2:20	1:55	3:06	2:20	0:49	8:29	0:57	0:42	2:06	1:49	3:40	6:33	1:35
PUBLIC	3:30	0:49	3:58	2:35	2:12	1:31	0:56	1:45	2:55	2:23	3:46	2:30	1:59
TREE	2:03	4:35	1:25	1:31	2:57	3:14	1:30	2:02	1:20	4:29	2:22	2:46	2:22
UNDETERMINED	1:25	0:15	0:42	1:19	0:13	1:47	0:46	0:26	1:52	1:20	0:46	1:15	0:53
WEATHER	3:11	2:11	2:31	4:27	3:56	1:09	1:45	3:07	3:15	2:49	2:35	2:43	2:56

Chart 8.4 - % SAIDI per Cause by Month

The following chart shows the percentage SAIDI contribution by causes for outages excluding major event days.

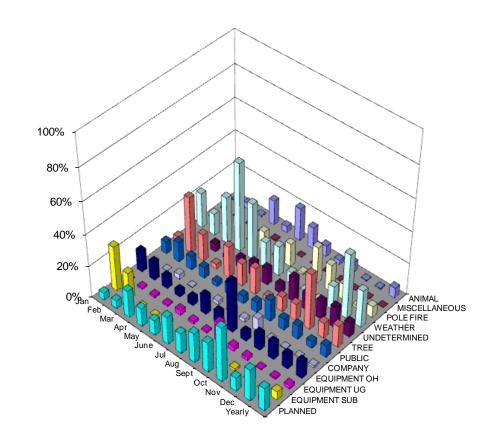

% SAIDI

Momentary Interruption Causes

The cause for many momentary interruptions is unknown. Because faults are temporary, the cause goes unnoticed even after the line is patrolled. Momentary outages are recorded using our SCADA system (System Control and Data Acquisition). On average, about 88% of Avista's customers are served from SCADA controlled stations.

Table 9.1 - % MAIFI per Cause by Office

The following table lists the percentage MAIFI contribution by causes for outages excluding major event days.

												All
REASON	CDC	COC	DAC	GRC	KEC	LCC	OTC	PAC	SAC	SPC	DPC	Offices
ANIMAL	2.5%	0.0%	0.0%	0.5%	2.0%	10.0%	0.0%	2.2%	1.8%	4.1%	0.0%	3.2%
POLE FIRE	0.6%	5.5%	0.0%	0.7%	0.0%	0.0%	0.0%	1.8%	0.0%	1.2%	0.0%	1.0%
WEATHER	10.6%	8.1%	11.0%	22.2%	25.3%	4.3%	27.4%	27.9%	15.4%	8.8%	0.0%	13.4%
TREE	0.0%	0.0%	0.0%	1.7%	17.5%	1.3%	0.0%	0.0%	0.0%	0.0%	0.0%	1.2%
PUBLIC	0.0%	0.0%	0.0%	1.1%	0.0%	1.4%	0.0%	0.0%	0.0%	0.0%	0.0%	0.3%
MISC	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	8.4%	0.0%	0.0%	0.0%	0.0%	0.1%
COMPANY	2.9%	2.5%	32.5%	0.0%	0.0%	0.7%	0.0%	0.0%	0.0%	1.3%	0.0%	2.0%
UNDETERMINED	80.7%	81.5%	56.5%	70.9%	41.2%	80.4%	46.8%	67.7%	77.9%	78.1%	0.0%	74.4%
EQUIPMENT UG	0.0%	0.0%	0.0%	0.0%	2.9%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.1%
EQUIPMENT OH	1.3%	0.0%	0.0%	1.3%	0.0%	0.0%	17.5%	0.0%	4.9%	4.8%	0.0%	2.0%
PLANNED	1.4%	2.3%	0.0%	1.6%	11.0%	1.8%	0.0%	0.4%	0.0%	1.7%	0.0%	2.2%

CDC	Coeur d'Alene	LCC	Lewiston-Clarkston
COC	Colville	OTC	Othello
DAC	Davenport	PAC	Palouse
DPC	Deer Park	SAC	Sandpoint
GRC	Grangeville	SPC	Spokane
KEC	Kellogg/ St. Maries		

Table 9.1.1 - % MAIFI per Cause by Office (Washington only)

The following table lists the percentage MAIFI contribution by causes for outages excluding major event days.

REASON	coc	DAC	отс	SPC	DPC	PAC-WA	LCC-WA	All WA Offices
ANIMAL	7.63%	8.11%	2.02%	11.67%	1.97%	2.91%	62.25%	11.31%
COMPANY	1.59%	10.91%	3.57%	13.25%	0.07%	6.80%	0.00%	8.31%
MISCELLANEOUS	0.00%	3.89%	0.00%	0.00%	0.00%	0.02%	0.00%	0.23%
POLE FIRE	11.32%	21.55%	3.71%	6.84%	0.36%	1.39%	0.00%	7.65%
PUBLIC	1.57%	3.75%	15.72%	9.82%	10.77%	7.30%	8.90%	7.19%
TREE	9.70%	1.19%	0.06%	3.89%	9.00%	18.50%	0.01%	6.85%
UNDETERMINED	24.93%	8.85%	46.12%	11.03%	37.03%	41.69%	0.12%	19.09%
WEATHER	8.62%	11.15%	5.23%	17.02%	10.47%	13.83%	0.41%	12.98%
EQUIPMENT OH	16.17%	18.56%	14.76%	10.41%	8.57%	4.35%	0.19%	11.18%
EQUIPMENT UG	0.76%	0.09%	0.27%	0.64%	6.24%	0.15%	0.18%	0.61%
EQUIPMENT SUB	0.00%	0.00%	0.00%	0.00%	0.00%	0.00%	26.36%	1.23%
PLANNED	17.71%	11.96%	8.57%	15.44%	15.53%	3.05%	1.59%	13.40%

COC Colville OTC Othello

DAC Davenport PAC-WA Palouse Washington

DPC Deer Park SPC Spokane

LCC-WA Lewiston-Clarkston Washington

Chart 9.1 - % MAIFI per Cause by Office

The following chart shows the percentage MAIFI contribution by causes for outages excluding major event days.

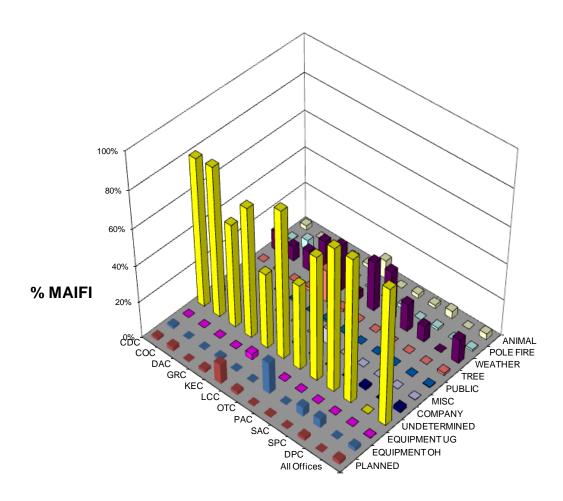



Table 9.2 - % MAIFI per Cause by Month

The following table lists the percentage MAIFI contribution by causes for outages excluding major event days.

REASON	Jan	Feb	Mar	Apr	May	June	Jul	Aug	Sept	Oct	Nov	Dec	Yearly
ANIMAL	5.0%	0.0%	5.8%	7.9%	0.0%	7.6%	1.7%	4.2%	4.9%	0.0%	0.0%	0.6%	3.2%
POLE FIRE	0.0%	0.9%	5.3%	0.0%	1.7%	0.0%	0.0%	0.0%	3.0%	0.0%	2.5%	0.0%	1.0%
WEATHER	10.5%	12.5%	22.8%	0.0%	26.1%	9.9%	19.8%	4.5%	0.0%	0.0%	28.2%	7.6%	13.4%
TREE	0.0%	0.0%	1.4%	1.1%	9.0%	0.7%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	1.2%
PUBLIC	0.0%	0.0%	0.0%	1.4%	0.0%	1.6%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.3%
MISC	0.0%	0.0%	0.0%	0.0%	0.0%	1.2%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.1%
COMPANY	4.0%	0.0%	0.0%	10.2%	6.5%	0.0%	0.7%	0.0%	0.0%	0.0%	2.1%	0.0%	2.0%
UNDETERMINED	80.3%	83.2%	61.8%	74.0%	55.3%	71.5%	73.7%	84.8%	88.9%	91.6%	64.4%	86.7%	74.4%
EQUIPMENT UG	0.0%	0.0%	0.0%	0.0%	1.4%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.0%	0.1%
EQUIPMENT OH	0.0%	2.5%	2.9%	4.4%	0.0%	5.2%	0.0%	3.4%	0.0%	0.0%	0.0%	5.1%	2.0%
PLANNED	0.2%	0.9%	0.0%	1.1%	0.1%	2.3%	4.1%	3.1%	3.2%	8.4%	2.8%	0.0%	2.2%

Chart 9.2 - % MAIFI per Cause by Month

The following chart shows the percentage MAIFI contribution by causes for outages excluding major event days.

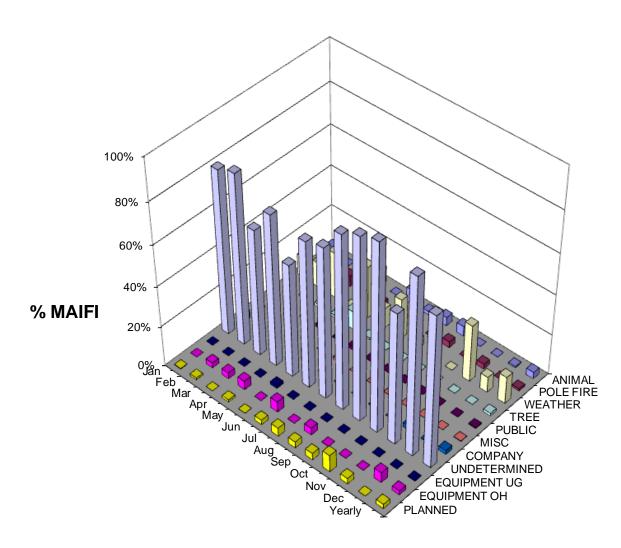

Major Event Day Causes

Chart 10.1 – % SAIFI by Cause Code for the Major Event Days

A chart could not be produced as there were no Major Event Days in 2011.

Table 10.1 – % SAIFI by Sub Cause Code for the Major Event Days

A table could not be produced as there were no Major Event Days in 2011.

Table 10.2 – Yearly Summary of the Major Event Days

Table 10.2 is provided as an initial review of Major Event Day information. The main premise of the IEEE Major Event Day calculation is that using the 2.5b method should classify 2.3 days each year as MED's. The following table shows the previous major event days, the daily SAIDI value and the relationship of the yearly T_{MED} .

Year	Date	SAIDI	$T_{ ext{MED}}$	
2004	05-21-2004	7.11	6.35	
	08-02-2004	7.36		
	12-08-2004	31.00		
2005	06-21-2005	39.53	4.916	
	06-22-2005	9.03		
	08-12-2005	19.60		
2006	01-11-2006	12.10	7.058	
	03-09-2006	8.58		
	11-13-2006	30.79		
	12-14-2006	29.26		
	12-15-2006	158.31		
2007	01-06-2007	9.98	8.017	
	06-29-2007	32.64		
	07-13-2007	12.79		
	08-31-2007	21.30		
2008	01-27-2008	17.57	9.224	
	07-10-2008	36.74		
	08-18-2008	9.49		
2009	None		9.925	
2010	5/3/2010	21.04	11.110	
	11/16/2010	68.67		
2011	None		10.848	
2012			9.489	

Interruption Cause Codes


Table 11.1 – Interruption Cause Codes

Proposed (Changes Only)	CATEGORY	Proposed	
		(Changes Only)	Definition
	Bird		Outages caused by animal contacts. Specific animal called out in sub category.
	Squirrel		ariirriai called out iii sub category.
	-		
	0		
	Car Hit Pad		Underground outage due to car, truck, construction equipment etc. contact with pad transformer, junction enclosure etc
			Overhead outage due to car, truck, construction
	Car Hit Pole		equipment etc. contact with pole, guy, neutral etc.
	Dig In		Dig in by a customer, a customer's contractor, or another utility.
	Fire		Outages caused by or required for a house/structure or field/forest fire.
	Tree		Homeowner, tree service, logger etc. fells a tree into the line.
	Other		Other public caused outages
	Dig in		Dig in by company or contract crew.
	Other		Other company caused outages
	Arrestors		Outages caused by equipment failure. Specific
	Canacitor		equipment called out in sub category.
	Recloser		
	-		
	Wildlife Guard		Wildlife guard failed or caused an outage
	URD Cable - Pri		Outages caused by equipment failure. Specific equipment called out in sub category.
	URD Cable- Sec		
	Connector - Sec		
	Elbow		
	Junctions		
	Primary Splice		
	Termination		
	Transformer - UG		
	Other		
Proposed (Changes Only)	SUB	Proposed (Changes Only)	Definition
	Proposed (Changes Only)	Underground Other Car Hit Pad Car Hit Pole Dig In Fire Tree Other Dig in Other Arrestors Capacitor Conductor - Pri Conductor - Pri Connector - Pri Connector - Sec Crossarm- rotten Cutout / Fuse Insulator Insulator Pin Other Pole - Rotten Recloser Regulator Switch / Disconnect Transformer - OH Wildlife Guard URD Cable - Pri URD Cable - Pri URD Cable - Sec Connector - Sec Elbow Junctions Primary Splice Termination Transformer - UG Other Proposed SIIR	Underground Other Car Hit Pad Car Hit Pole Dig In Fire Tree Other Dig in Other Arrestors Capacitor Conductor - Pri Conductor - Sec Connector - Pri Connector - Sec Crossarm - rotten Cutout / Fuse Insulator Insulator Pin Other Pole - Rotten Recloser Regulator Switch / Disconnect Transformer - OH Wildlife Guard URD Cable - Pri URD Cable - Sec Connector - Sec Elbow Junctions Primary Splice Termination Transformer - UG Other Proposed SIIR Proposed

CATEGORY	CATEGORY	
EQUIPMENT SUB	High side fuse Bus Insulator High side PCB High side Swt / Disc Low side OCB/Recloser Low side Swt / Disc Relay Misoperation Regulator Transformer Other	
MISCELLANEOUS	SEE REMARKS	For causes not specifically listed elsewhere
NOT OUR PROBLEM (Outages in this category are not included in reported statistics)	Customer Equipment SEE REMARKS	Customer equipment causing an outage to their service. If a customer causes an outage to another customer this is covered under Public.
,	Other Utility	Outages when another utility's facilities cause an outage on our system.
POLE FIRE		Used when water and contamination causes insulator leakage current and fire. If insulator is leaking due to material failure list under equipment failure. If cracked due to gunfire use customer caused other.
PLANNED	Maintenance / Upgrade Forced	Outage, normally prearranged, needed for normal construction work Outage scheduled to repair outage damage
TREE	Tree fell	For outages when a tree falls into distribution primary/secondary or transmission during normal weather Tree growth causes a tree to contact distribution
	Tree growth Service	primary/secondary or transmission during normal weather. For outages when a tree falls or grows into a service.
	Weather	When snow and wind storms causes a tree or branch to fall into, or contact the line. Includes snow loading and unloading.
UNDETERMINED		Use when the cause cannot be determined
WEATHER	Snow / Ice	Outages caused by snow or ice loading or unloading on a structure or conductor. Use weather tree for snow and ice loading on a tree.
	Lightning	Lightning flashovers without equipment damage. Equipment failures reported under the equipment type.
	Wind	Outages when wind causes conductors to blow into each other, another structure, building etc.

Office Areas

Chart 12.1 - Office Areas

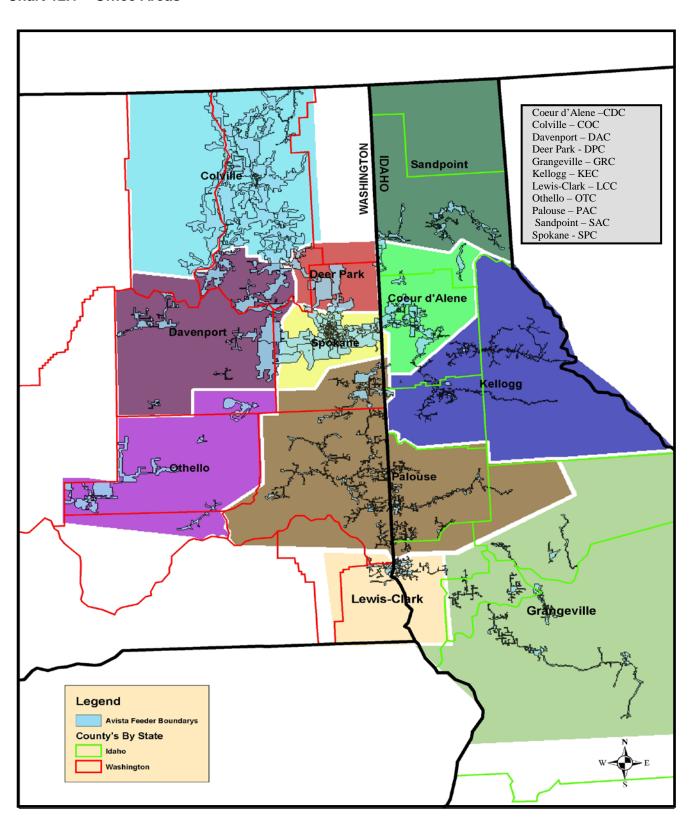

Indices Calculations

Sustained Interruption

• An interruption lasting longer than 5 minutes.

Momentary Interruption Event

An interruption lasting 5 minutes or less. The event includes all momentary interruptions occurring
within 5 minutes of the first interruption. For example, when an interrupting device operates two,
three, or four times and then holds, it is considered a single event.

SAIFI – System Average Interruption Frequency Index

- The average number of sustained interruptions per customer
- = The number of customers which had *sustained interruptions*

Total number of customers served

$$\bullet \quad = \quad \frac{\sum N_i}{N_T}$$

MAIFI_E - Momentary Average Interruption Event Frequency Index

- The average number of momentary interruption events per customer
- = The number of customers which had *momentary interruption events*

Total number of customers served

$$\bullet = \frac{\sum ID_{E}N_{i}}{N_{T}}$$

 MAIFI can be calculated by one of two methods. Using the number of momentary interruptions or the number momentary events. This report calculates MAIFI_E using momentary events. The event includes all momentary interruptions occurring within 5 minutes of the first interruption. For example, when an automatic interrupting device opens and then recloses two, or three times before it remains closed, it is considered a single event.

SAIDI – System Average Interruption Duration Index

- Average sustained outage time per customer
- <u>Outage duration multiplied by the customers effected for all *sustained interruptions*</u>

Total number of customers served

$$\bullet = \frac{\sum r_i N_i}{N_T}$$

CAIDI – Customer Average Interruption Duration Index

- Average restoration time
- = Outage duration multiplied by the customers effected for all *sustained interruptions*The number of customers which had *sustained interruptions*

 $\bullet = \frac{\sum r_i N_i}{\sum N_i}$

Quantities

i = An interruption event;

 r_i = Restoration time for each interruption event;

T = Total;

 $ID_E = Number of interrupting device events;$

 N_i = Number of interrupted customers for each interruption event during the reporting period;

 N_T = Total number of customers served for the area being indexed;

$CEMI_n$ – Customers Experiencing Multiple Sustained Interruptions more than n.

- $CEMI_n$
- = <u>Total Number of Customers that experience more than *n* **sustained interruptions**Total Number of Customers Served</u>

 $\bullet = \underline{CN_{(k>n)}} \\ N_T$

CEMSMI_n – Customers experiencing multiple sustained interruption and momentary interruption events.

- CEMSMIn
- = $\frac{\text{Total Number of Customers experiencing more than } n \text{ interruptions}}{n \text{ interruptions}}$

Total Number of Customers Served

 $\bullet = \underbrace{CNT_{(k>n)}}_{N_T}$

MED - Major Event Day

A major event day is a day in which the daily system SAIDI exceeds a threshold value. Its purpose is to allow major events to be studied separately from daily operation, and in the process, to better reveal trends in daily operation that would be hidden by the large statistical effect of major events.

T_{MED} is calculated (taken from the IEEE 1366-2003 Standard)

The major event day identification threshold value, T_{MED}, is calculated at the end of each reporting period (typically one year) for use during the next reporting period as follows:

- a) Collect values of daily SAIDI for five sequential years ending on the last day of the last complete reporting period. If fewer than five years of historical data are available, use all available historical data until five years of historical data are available.
- b) Only those days that have a SAIDI/Day value will be used to calculate the T_{MED} (do not include days that did not have any interruptions).
- c) Take the natural logarithm (In) of each daily SAIDI value in the data set.
- d) Find a(Alpha), the average of the logarithms (also known as the log-average) of the data set.
- e) Find p(Beta), the standard deviation of the logarithms (also known as the log-standard deviation) of the data set.
- f) Compute the major event day threshold, TMED, using equation (25).

$$T_{MED} = e^{(a+2.5 b)}$$
 (25)

g) Any day with daily SAIDI greater than the threshold value TMED that occurs during the subsequent reporting period is classified as a major event day. Activities that occur on days classified as major event days should be separately analyzed and reported.

Avista Utilities 57

Numbers of Customers Served

The following numbers of customers were based on the customers served at the beginning of the year. These numbers were used to calculate indices for this report.

Table 13.1 - Numbers of Customers Served

Office	Customers	% of Total		
Coeur d'Alene	50519	13.9%		
Colville	18157	5.0%		
Davenport	6917	1.9%		
Deer Park	10681	2.9%		
Grangeville	10178	2.8%		
Kellogg/St. Maries	14346	3.9%		
Lewis-Clark	29368	8.1%		
Othello	6727	1.9%		
Palouse	38738	10.7%		
Sandpoint	14677	4.0%		
Spokane	163313	44.9%		
System Total	363,621			

Attachment 1 - SAIDI and SAIFI Historical Summary

See attachment.

Company Contact

For further information regarding this document, please contact:

WUTC Electric Service Reliability Report Avista Utilities

E. 1411 Mission Avenue

Spokane, WA 99220

(509) 495 - 2034 (phone)

(509) 495 - 4975 (phone)

(509) 495 - 4060 (fax)